

Special Process: Plating System Assessment Cover Sheet				
Facility Name: Master Finish Company				
Address: 2100 Nelson Ave SE, Grand Rapids, MI, USA				
Phone Number: (616) 245-1228				
Current Quality Certification(s): ISO 9001:2015				
N. 1. (D) 6. F. 1. (1) 5. 77. 54				
Number of Plating Employees at this Facility: 51				
Captive Plater (Y/N): No				
Commercial Plater (Y/N): Yes				
Date of Assessment: 06-03-2025				
Date of Previous Assessment: 06-03-2024				
Date of Re-assessment (if necessary): N/A				
Type(s) of P	lating Processing at this Facility:			
Process Table A:	Process Table F:			
Zinc No	Hard Chrome Plating No			
Zinc Alloy Plating No				
Process Table B:	Process Table G:			
Mechanical Plating No	Electroless Nickel No			
Process Table C:	Process Table H:			
Decorative Plating of Metal Substrates YES	Hydrogen Embrittlement Relief Process YES			
Process Table D:	Process Table I:			
Decorative Plating of Plastic Substrates No	Process Control and Testing Equipment Verification and Calibration YES			
Process Table E:	TES			
Electropolish and Chrome Flash No				
Licensponent and children hash The				
Personnel Contacted:	L			
Name: John Mulder	Phone: (616) 245-1228			
Melissa Simpson				
Aaron Mulder				
Kevin Steele				
Auditors/Assessors:				
Name: Gordan Lozic	Phone: (616) 245-1228			
N 1 (N)				
Number of Nonconforming Findings from Section 1 and Se	ection 2:			
None				
Number of Nonconforming Findings in the Job Audit(s):				
None Number of Nonconforming Findings in the Process Table(c):			
None				



Section 1 - Management Responsibility & Quality Planning

1.1 There shall be a dedicated and qualified surface finishing person on site.

- To ensure readily available expertise, there shall be a dedicated and qualified surface finishing person on site.
- This individual shall be a full-time employee and the position shall be reflected in the organization chart.
- A job description shall exist identifying the qualifications for the position including chemical and surface finishing/surface finishing knowledge.
- The qualifications shall include a minimum of 5 years' experience in surface finishing operation or a combination of a minimum of 5 years of relevant formal education and surface finishing experience.

Guidance	Objective Evidence	Conforming Nonconforming NA
What is this person's title?	CEO	Conforming
Is this position reflected in the organizational chart?	Yes	Conforming
Is there a documented job description listing all the required qualifications and responsibilities of this position?	Yes	Conforming
Describe in detail this person's educational background and practical experience.	Engineering degree, Certified Electro Finisher	Conforming
How many years of process experience at a plating facility does this person have?	15	Conforming
Is this individual a full-time employee at the location being audited?	Yes	Conforming

Comments:

1.2

Section 1 - Management Responsibility & Quality Planning The facility shall perform advanced quality planning.

- The organization shall incorporate a documented advanced product quality planning process.
 A feasibility study shall be performed and internally approved for each new part or process. Similar parts can be grouped into part families for this effort as defined by the organization.
- After the part approval process is approved by the customer, no process changes are allowed unless approved by the customer.
- The organization shall contact the customer when clarification of process changes is required. This clarification of process changes shall be documented.

Guidance	Objective Evidence	Conforming Nonconforming NA
Does the facility use a documented advanced quality planning process?	Yes. APQP weekly meetings, APQP kick off meetings with customers, APQP checklists completed for each new program	Conforming
Does the facility perform a documented internal feasibility study for each part before processing? If no, does the facility perform a documented internal feasibility study for similar part types or family of parts before processing?	Yes. Coating Build Capability studies, Rack maps, Lessons Learned	Conforming
What is the procedure for changing the process after PPAP?	Process change validation	Conforming
Comments:		

Section 1 - Management Responsibility & Quality Planning
--

1.3 The facilities FMEAs shall be up to date and shall reflect the current process.



- The organization shall incorporate the use of a documented Failure Mode and Effects Analysis (FMEA) and ensure the FMEAs are updated to reflect current part quality status.
- The FMEA shall be written for each part or part family or they may be process-specific and written for each process.
- FMEAs shall address every process step from part receipt to part shipment.
- A cross-functional team shall be used in the development of the FMEA.
- · All special characteristics, as defined by the organization and its customers, shall be identified, defined, and addressed in the FMEA.

Guidance	Objective Evidence	Conforming Nonconforming NA
Does the facility have a documented Failure Mode and Effects Analysis (FMEA) in use?	Yes. Part specific PPAP workbooks	Conforming
Identify the names and job function of the team members used in the development of the FMEA.	Aaron Mulder, CEO Justin Hulsebus, Plating Manager Gordan Lozic, Quality Manager Mikayla Mathewson, QA Tech Lead	Conforming
Identify if the FMEA is written for each part, part family or process specific.	Part specific, unless PPAP-ing LH and RH sets	Conforming
Are all FMEAs consistent with all associated documentation such as control plans, work instructions and shop travelers?	Yes	Conforming
Do all FMEAs include every process step from part receipt to part shipment?	Yes	Conforming
Are special characteristics, as defined by the organization and its customers, identified, defined, and addressed in the FMEAs?	Yes	Conforming
Provide evidence that the FMEA has been updated in response to quality issues.	Corrective Action log, updated FMEAs	Conforming

Section 1 - Management Responsibility & Quality Planning

1.4

The process control plans shall be up to date and shall reflect the current process.

- The organization shall incorporate the use of a documented control plan and ensure the control plans are updated to reflect current controls.
- The control plans shall be written for each part or part family or they may be process-specific.
- The control plans shall address all process steps from part receipt to part shipment and identify all equipment used and all key surface finishing process parameters as defined by the organization.
- A cross-functional team shall be used in the development of control plans, which shall be consistent with all associated documentation such as work instructions, shop travelers, and FMEAs.
- · All special characteristics, as defined by the organization and its customers, shall be identified, defined, and addressed in the control plans.
- The control plan shall detail the product and process characteristics, and controls including testing frequency and sample size.

Guidance	Objective Evidence	Conforming Nonconforming NA
Does the facility have a documented control plan in use?	Yes	Conforming
Identify if the control plan is written for each part, part family or process specific.	Part specific, unless PPAP-ing LH and RH sets	Conforming
Do all control plans include every process step from part receipt to part shipment?	Yes	Conforming
Does the control plan identify all key surface finishing process parameters?	Yes	Conforming





Identify the names and job function of the team members used in the development of the control plan.	Aaron Mulder, CEO Justin Hulsebus, Plating Manager Gordan Lozic, Quality Manager Mikayla Mathewson, QA Tech Lead	Conforming
Are the control plans consistent with all associated documentation such as work instructions, shop travelers, specifications and FMEAs?	Yes	Conforming
Provide evidence that sample sizes and frequencies for evaluation of process and product characteristics are addressed and consistent with the minimum requirements.	Control plans consistent with plating specification requirements	Conforming
Are special characteristics, as defined by the organization and its customers, identified, defined, and addressed in the control plans?	Yes	Conforming
Provide evidence that the control plan has been updated in response to quality issues, customer requirements and process changes.	Corrective Action log, updated Control Plans	Conforming


	Section 1 - Management Responsibility & Quality Planning	
1.5	All surface finishing related and referenced specifications shall be up to date and available. For example: SAE, AIAG, ASTM, General Motors, Ford, FCA, Toyota, Volvo Truck.	

A document control system is pertinent for the handling and internal distribution of received customer specifications and to keep up to date with national or global standards related to surface finishing processes. To ensure all customer requirements are understood and satisfied, the organization shall have all related surface finishing and customer referenced standards and specifications available for use and a process to ensure that they are current.

- The organization shall have a process to ensure the timely review, distribution, and implementation of all customer and industry engineering standards and specifications and changes based on customer-required schedule. This process shall be executed as soon as possible and shall not exceed two weeks.
- The organization shall document this process of review and implementation, and it shall address how customer and industry documents are obtained, how they are maintained within the organization, how the current status is established, and how the relevant information is cascaded to the shop floor within the two-week period.
- The organization shall identify who is responsible for performing these tasks.

Guidance	Objective Evidence	Conforming Nonconforming NA
Does the organization have all related surface finishing and customer referenced standards and specifications available for use?	Yes	Conforming
How are standards and specifications obtained?	Provided by customers during PPAP or after revisions	Conforming
Describe the system and timing used to maintain the standards and specifications to ensure that they are up to date.	Customers responsible for providing updated OEM specifications	Conforming
Define that process used to review and communicate within the two-week period updated standards and specifications throughout the organization. Include the names and job functions of the responsible personnel.	Gordan Lozic, Quality Manager	Conforming
Comments:	•	•

	Section 1 - Management Responsibility & Quality Planning	
1.6	1.6 There shall be documented process instructions.	

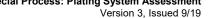



- The organization shall have written process instructions for all active parts or family of parts, including relevant part specific requirements. Examples of part specific requirements include process line, plating type, load size, rectifier settings, etc.
- These process instructions may take the form of work instructions, job card, computer-based recipes, or other similar documents.

Guidance	Objective Evidence	Conforming Nonconforming NA
Does the organization have written process instructions for all active parts or family of parts and include all relevant operating parameters?	Yes	Conforming
What form of process specification is used? (These may be in the form of work instructions, job card, computer-based recipes, or other similar documents.)	Work instructions, computer-based plating recipes	Conforming

Section 1 - Management Responsibility & Quality Planning

1.7

A valid product capability study shall be performed.

To demonstrate each process is capable of yielding acceptable product, the organization shall perform product capability studies for the initial validation of each process, after relocation of any process equipment, and after a major change of any process or equipment. The organization shall define what constitutes a major change.

- Initial product capability studies shall be conducted for all surface finishing processes per line as defined in scope of work and in accordance with customer requirements. Capability study techniques shall be appropriate for the surface finishing product characteristics, (e.g., surface finishing thickness, corrosion resistance, etc.).
- An action plan shall exist to address the steps to be followed in case capability indices fall outside customer requirements or established ranges.

Guidance	Objective Evidence	Conforming Nonconforming NA
Has an initial product capability study been performed?	Yes	Conforming
Are studies conducted for each surface finishing process for each line in the facility?	Yes	Conforming
Has a new study been completed after relocation of any process equipment, major rebuild of any equipment, or any significant change in process chemistry?	Yes	Conforming
How does the organization define what constitutes a major change?	Changes to the plating line, not plating recipe	Conforming
What steps are followed when capability indices fall outside specified requirements?	PDCA	Conforming

Comments:

Section 1 - Management Responsibility & Quality Planning

1.8

The organization shall collect, analyze, and react to product and process data over time.

- The analysis of product characteristics and processes parameters over time can yield vital information for defect prevention efforts.
- Methods of analysis shall include ongoing trend or historical data analysis of special product and process parameters.
- The organization shall determine which parameters to include in such analysis.

		Conforming
Guidance	Objective Evidence	Nonconforming
		NA



What product charac	cteristics and process parameters are used?	Plating thickness, plating adhesion, corrosion, appearance, plating baths chemical analysis	Conforming
How is the ongoing to	rend or historical data reviewed and analyzed?	SPC	Conforming
How does the organi	zation use this data to prevent future failures and improve the quality system?	PDCA, updates made to process and testing frequency	Conforming
Comments:		·	
	Section 1 - Management Responsibili	ty & Quality Planning	
1.9	All process control and testing records must be retained for a minimum of o	ne calendar year after the year in which they were created.	
	Guidance	Objective Evidence	Conforming Nonconforming NA
What is the process t	to retain these records?	Electronic logs and databases	Conforming
What is the process f	for retention of customer specific documents with longer retention times?	Program life + 3 years	Conforming
Comments:		•	
	Section 1 - Management Responsibili	ty & Quality Planning	
Management or ma	There shall be a process in place to review the monitor anagement designee shall review the monitoring systems/logs at specified intervals.	ing systems/logs at specified intervals.	
 Management or ma In the case of Hydro 			Conforming
 Management or ma In the case of Hydro 	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipme		Conforming Nonconforming NA
Management or ma In the case of Hydro The organization sh	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipme hall have reaction plans for nonconformances to process requirements.	ent and shall not exceed 24 hours.	Nonconforming
Management or ma In the case of Hydro The organization sh	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipme nall have reaction plans for nonconformances to process requirements. Guidance	ent and shall not exceed 24 hours. Objective Evidence	Nonconforming NA
Management or ma In the case of Hydro The organization sh Define the process in	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipme hall have reaction plans for nonconformances to process requirements. Guidance I place to gather and review this information.	Objective Evidence Electronic logs, MasterTracker software	Nonconforming NA Conforming
 Management or ma In the case of Hydro The organization sh Define the process in Identify the manager In the case of Hydrog	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipmentall have reaction plans for nonconformances to process requirements. Guidance In place to gather and review this information. To r management designee reviewing the process records from the monitoring systems/logs.	Objective Evidence Electronic logs, MasterTracker software Plating Manager, Quality Manager	Nonconforming NA Conforming Conforming
 Management or ma In the case of Hydro The organization sh Define the process in Identify the manager In the case of Hydrog	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipmentall have reaction plans for nonconformances to process requirements. Guidance In place to gather and review this information. For management designee reviewing the process records from the monitoring systems/logs. In place to gather and review the review taking place within the 24 hour period?	Objective Evidence Electronic logs, MasterTracker software Plating Manager, Quality Manager Yes	Nonconforming NA Conforming Conforming Conforming
Management or ma In the case of Hydro The organization sh Define the process in Identify the manager In the case of Hydrog Describe reaction plane.	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipmentall have reaction plans for nonconformances to process requirements. Guidance In place to gather and review this information. For management designee reviewing the process records from the monitoring systems/logs. In place to gather and review the review taking place within the 24 hour period?	Objective Evidence Electronic logs, MasterTracker software Plating Manager, Quality Manager Yes Suspect Load procedure and Quality hold	Nonconforming NA Conforming Conforming Conforming
Management or ma In the case of Hydro The organization sh Define the process in Identify the manager In the case of Hydrog Describe reaction plane.	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipmentall have reaction plans for nonconformances to process requirements. Guidance a place to gather and review this information. or management designee reviewing the process records from the monitoring systems/logs. gen Embrittlement baking, is the review taking place within the 24 hour period? ans for nonconformances to the written process requirements.	Objective Evidence Electronic logs, MasterTracker software Plating Manager, Quality Manager Yes Suspect Load procedure and Quality hold	Nonconforming NA Conforming Conforming Conforming
Management or ma In the case of Hydro The organization sh Define the process in Identify the manager In the case of Hydrog Describe reaction pla Comments:	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipmenall have reaction plans for nonconformances to process requirements. Guidance In place to gather and review this information. To or management designee reviewing the process records from the monitoring systems/logs. Gen Embrittlement baking, is the review taking place within the 24 hour period? Sens for nonconformances to the written process requirements. Section 1 - Management Responsibility	Objective Evidence Electronic logs, MasterTracker software Plating Manager, Quality Manager Yes Suspect Load procedure and Quality hold	Nonconforming NA Conforming Conforming Conforming
Management or ma In the case of Hydro The organization sh Define the process in Identify the manager In the case of Hydrog Describe reaction pla Comments: 1.11	anagement designee shall review the monitoring systems/logs at specified intervals. ogen Embrittlement avoidance and relief, review shall occur prior to parts being released for shipment and have reaction plans for nonconformances to process requirements. Guidance a place to gather and review this information. or management designee reviewing the process records from the monitoring systems/logs. gen Embrittlement baking, is the review taking place within the 24 hour period? ans for nonconformances to the written process requirements. Section 1 - Management Responsibility internal assessments shall be completed at a minimum once every 12 months us	Objective Evidence Electronic logs, MasterTracker software Plating Manager, Quality Manager Yes Suspect Load procedure and Quality hold ty & Quality Planning ing the latest revision of the CQI-11 Plating System Assessment.	Nonconforming NA Conforming Conforming Conforming Conforming Conforming Nonconforming



Section 1 - Management Responsibility & Quality Planning

1.12 There shall be an internal system in place to authorize reprocessing and it shall be documented.

- The quality management system shall include a documented process for reprocessing that shall include authorization from the quality manager or a designated individual.
- The reprocessing procedure shall describe product characteristics for which reprocessing is allowed as well as those characteristics for which reprocessing is not permissible.
- All reprocessing activity shall require a separate rework specific process control sheet or other identification method, issued by qualified technical personnel denoting the necessary surface finishing modifications.
- Records shall clearly indicate when and how any material has been reprocessed.
- The rework of material shall comply with the customer's specifications and/or requirements.

Guidance	Objective Evidence	Conforming Nonconforming NA
Describe the procedure for authorizing reprocessing of nonconforming material.	Quality department determines acceptable rework procedures	Conforming
Does the reprocessing procedure describe product characteristics that allow or not allow reprocessing?	Yes	Conforming
Did the quality manager or manager's designee authorize the rework and determine the reprocessing procedure?	Yes	Conforming
How do you identify that material has been reprocessed?	Rework tags, "RW" suffix for reworked lots	Conforming
Do the records clearly indicate when and how any material has been reprocessed including the quality manager's authorization of release?	Yes	Conforming
Provide evidence that the rework complies with your customer's specifications and/or requirements.	Testing data and visual inspection results	Conforming

Comments:

Section 1 - Management Responsibility & Quality Planning

1.13

The Quality Department shall review, address, and document customer and internal concerns.

The quality management system shall include a process for documenting, reviewing, and addressing customer concerns and any other concerns internal to the organization.

Guidance	Objective Evidence	Conforming Nonconforming NA
Describe the procedure for reviewing and addressing external customer and internal concerns.	Quality Alerts, 8D's, Customer complaint log, Corrective Action log	Conforming
Describe the problem solving approach that is used.	PDCA, 8D, 5-Why	Conforming
Describe the communication process used to respond to the originator.	As requested by customer. Internally by email.	Conforming
Provide a recent example of this procedure in use.	Quality Alert #1219 shared by email on 5/22/25	Conforming

Comments:

Section 1 - Management Responsibility & Quality Planning

1.14 The organization shall have a continual improvement process.

- The continual improvement process shall be designed to achieve improvements in quality and productivity.
- Identified actions shall be prioritized and shall include timing (estimated completion dates).
- The organization shall show evidence of program effectiveness.



	Guidance	Objective Evidence	Conforming Nonconforming NA
Describe	e the continual improvement process used to achieve improvements in quality and productivity.	Daily plating huddles and weekly quality meetings with action items focused on quality improvement and defect prevention	Conforming
Provide	a recent example of how actions are identified, prioritized and completion dates assigned.	Daily platers huddle action items list from 6/2/25	Conforming
Describe	e how the organization measures the effectiveness.	Quality KPIs, Daily yield and scrap reports, weekly quality review	Conforming
Commei	nts:	•	
	Section 1 - Management Responsibility	& Quality Planning	
1.15	There shall be predefined personnel responsible for manag	ement of materials in quarantine area.	
Only the	e quality manager or designee may authorize the disposition of material from quarantine status.		
	Guidance	Objective Evidence	Conforming Nonconforming NA
Define t	the process for release of material from quarantine.	Control of non-conforming material procedure	Conforming
List the a	authorized personnel with job titles.	QA Manager, QA Tech Lead, QA Techs	Conforming
Review 6	evidence that only these persons are releasing materials from the quarantine area.	Hold sheets, Hol Area log	Conforming
Commei	nts:		
	Section 1 - Management Responsibility	& Quality Planning	
1.16	There shall be documented procedures and/or work instructions for all processes a	nd they shall be available to all of the organization's personnel.	
• These	shall be procedures or work instructions available to personnel covering their responsibilities. documents shall include instructions for addressing potential emergencies (such as power failure), equipment staring procedures.	t-up, equipment shut-down, product segregation (See 2.3, 2.8), product insp	ection, and genera
	Guidance	Objective Evidence	Conforming Nonconforming NA
Review t	the procedure/work instruction for process start-up and shut-down.	Weekly and daily start up and shut down procedures and checklists	Conforming
Review t	the procedure/work instruction for process control during operation.	Electronic plating recipes, TrueChem SPC software	Conforming
	the procedure in place to address potential emergencies? s power outage and/or equipment failure).	Suspect Load procedure and Quality hold procedure	Conforming
	the procedures for inspection of the product, in process or after completion.	Part specific inspection work instructions with photographs	Conforming
Verify th	hat these procedures/work instructions are accessible to personnel performing the job at all times.	Hard copies located on the production floor	Conforming
Comme	nts:		•
	Section 1 - Management Responsibility	& Quality Planning	





- The organization shall provide employee training for all operations.
- All employees, including backup and temporary employees, shall be trained.
- Documented evidence shall be maintained showing the employees trained and the evidence shall include an employee assessment.
- Management shall define the qualification requirements for each function, and ongoing or follow-up training shall also be addressed.

Guidance	Objective Evidence	Conforming Nonconforming NA
Review the process for initial training of all employees, including backup and temporary.	Training matrix	Conforming
Review the process for ongoing and/or follow-up training.	Training matrix	Conforming
Provide a recent copy of the training matrix.	Available upon request	Conforming
Provide documented evidence that shows how the organization verifies effectiveness of training.	Internal auditing	Conforming

Section 1 - Management Responsibility & Quality Planning

1.18

Essential management and supervisory functions shall be performed by qualified personnel at all times and a matrix of these essential responsibilities shall be available for review.

- The organization shall maintain a responsibility matrix identifying all essential management and supervisory functions and list the qualified personnel who may perform such functions.
- It shall identify both primary and secondary (backup) personnel for the essential functions (as defined by the organization).
- This matrix shall be readily available to management at all times.

Guidance	Objective Evidence	Conforming Nonconforming NA
Review and provide an example of the most recent matrix.	Training matrix, DMS system	Conforming
Confirm that the matrix includes both primary and secondary persons.	Training matrix, DMS system	Conforming
Describe how and where this information is made available.	Training matrix, DMS system, Job titles and descriptions	Conforming

Comments:

Section 1 - Management Responsibility & Quality Planning

1.19

There shall be a preventive maintenance program and maintenance data shall be utilized to form a predictive/preventive maintenance program.

- The organization shall have a documented preventive maintenance program for essential process equipment (as identified by the organization).
- The program shall be a closed-loop process that tracks maintenance efforts from request to completion to assessment of effectiveness.
- Equipment operators shall have the opportunity to report problems, and problems shall also be handled in a closed-loop manner.
- Company data, e.g., downtime, quality rejects, first time-through capability, recurring maintenance work orders, and operator-reported problems, shall be used to improve the preventive maintenance program.
- Maintenance data shall be collected and analyzed as part of a preventive maintenance program.

Guidance	Objective Evidence	Conforming Nonconforming NA
Show evidence that a documented preventive maintenance program exists.	PM Database	Conforming



Describe the process for reporting problems.	Work Order Request process via Work Order app MaintainX	Conforming
Provide a recent example showing that the person reporting the problem received feedback after the problem was reso	WO Process requires feedback of maintenance task, last feedback to QA on 5/28/25 by maintenance tech	Conforming
Give a recent example of how the program was used to prevent/predict potential equipment failure.	The cable track for hoist 4 was ordered and present before the failure occurred, this reduced downtime significantly	Conforming
How is the data being generated reviewed with management to improve the quality system?	Equipment Management Group reoccuring meeting to review key equipment maintenance metrics	Conforming
Comments:		
Section 1 - Management Responsibi	lity & Quality Planning	
1.20 The organization shall develop a critical spare part list and the parts	must be available to minimize production disruptions.	
Spare part suppliers, minimum quantity and lead times shall be documented.		
Guidance	Objective Evidence	Conforming Nonconforming NA
Provide the critical spare parts list.	Z:\Maintenance Department\Ashley\product key.xls	Conforming
Does the critical spare parts list include inventory, lead time and suppliers?	Data lives in Concur database for maintenance ordering	Conforming
Describe how and when the organization updates the list.	When new equipment is added the critical list is reviewed and updated	Conforming
What criteria is used to determine whether critical spare parts are kept at the facility or sourced off site.	Lead times, repair difficultiy	Conforming
Describe the process used to maintain minimum quantities.	As parts are consumed from inventory they are repleanished by	Conforming
Describe the process used to maintain minimum quantities.	ordering addiontal spare parts	



Section 2 - Floor and Material Handling Responsibility

2.1 The organization shall ensure that customer data entered into the receiving system matches the customer's shipping documents.

It is critical that all customer requirements and lot identification be correctly transferred to internal documents.

- The facility shall ensure that the data entered in the receiving system match the information on the customer's shipping documents.
- Documented processes and evidence of compliance shall exist, e.g., shop travelers, work orders, etc.
- Sometimes the material received does not precisely correspond to customer shipping documents. The facility shall have a detailed procedure in place to resolve receiving discrepancies.
- The requirements stated above apply to captive, in-house, commercial and all involved departments.

Guidance	Objective Evidence	Conforming Nonconforming NA
Describe the receiving process including listing the documentation used.	Customer Parts Receiving Process WIIC008	Conforming
Describe the process to identify the plating requirements.	APQP, Production routing process PRGEN005	Conforming
Describe the reaction process when material received does not correspond to the customer's documents.	General Quality Incoming Audit Guidelines WIQA002	Conforming

Comments:

Section 2 - Floor and Material Handling Responsibility

2.2 Is product clearly identified and stored throughout the surface finishing process and is lot traceability and integrity maintained?

Procedures are required for part and container identification to avoid incorrect processing or mixing of lots.

- As received, in-process, and finished product or material shall be properly segregated, identified, and stored in a dedicated and clearly defined area.
- Out-going lot(s) shall be traceable to the incoming lot(s).
- The discipline of precisely identifying lots and linking all pertinent information to them enhances the ability to do root cause analysis and continual improvement.

Guidance	Objective Evidence	Conforming Nonconforming NA
Describe the method that ensures the parts and lot numbers are correctly identified and maintained throughout the process.	Production routing process PRGEN005, Inventory Control System PRIC001, Unique load IDs	Conforming
Verify that received, in-process, and finished product or material is properly segregated, identified, and stored in a dedicated and clearly defined area.	Inventory Control System PRIC001	Conforming

Comments:

	Section 2 - Floor and Material Handling Responsibility
2.3	Procedures shall be adequate to prevent movement of nonconforming product into and out of the production system.

The control of suspect or nonconforming product is necessary to prevent inadvertent shipment or contamination of other lots.

- Procedures shall be adequate to prevent movement of nonconforming product into the production system.
- Procedures shall exist addressing authorized personnel, appropriate disposition, product identification and tracking of material flow in and out of hold area.
- Nonconforming hold area shall be clearly designated to ensure segregation of such material.



Guidance	Objective Evidence	Conforming Nonconforming NA
Where is the nonconforming holding area, and how is it identified?	1 north plant hold, 1 south plant hold, both identified with signage and indicated by the color RED	Conforming
Describe the procedure to prevent the unauthorized movement of nonconforming products.	PRQA002 Control of Non Conforming Product, PRGEN005 Production Routing Procedure	Conforming
Provide evidence that material movement in and out of this area is documented.	warehouse Management Software (Fishbowl) retains all data, Hold Area logs	
Commonto		

Section 2 - Floor and Material Handling Responsibility

2.4 For bulk processing there shall be a procedure to identify trap points throughout the entire process to reduce risk of unfinished, improperly coated and mixed parts.

- The organization shall have documented procedures to identify and monitor all trap points for each process/equipment.
- Monitoring of potential trap points shall occur at minimum every part changeover.
- Trap points may include: Plating barrels, part containers, loading and unloading equipment, spin dryers, transfer belts.

Guidance	Objective Evidence	Conforming Nonconforming NA
Describe the procedure to identify and monitor all trap points for each process and/or equipment.	WIGEN006 Trap Points	Conforming
Provide the list of trap points.	WIGEN006 Trap Points	Conforming

Comments:

Section 2 - Floor and Material Handling Responsibility

2.5

The handling, storage and packaging shall be adequate to ensure product quality is maintained throughout the entire process.


- Handling, storage, and packaging shall be adequate to ensure product quality.
- Part cleanliness shall be maintained throughout the process.
- All parts shall be stored in a controlled environment.

Guidance	Objective Evidence	Conforming Nonconforming NA
Which process steps have dedicated in-process containers?	Customer provided packaging is used	conforming
How are containers maintained to preserve part cleanliness?	Customer provided packaging is used and properly stored	conforming
Describe how the containers are inspected to ensure they are free of foreign material.	Customer provided packaging is used	conforming
What is used for liner material of customer containers before packing finished goods for shipment? (Materials like newspapers, used cardboard and bags should be avoided).	Customer provided packaging is used	conforming
Provide a list of dedicated storage areas that avoid exposure to contamination and corrosion. (Storage outdoors, near media blasting and corrosive processes such as acid tanks should be avoided).	Product is kept in the warehouse until ready to be processed	conforming
Comments:	•	,





	Section 2 - Floor and Material Handling Responsibility						
2.6	2.6 Each process step shall be documented and traceable.						
How	does the operator verify that all process steps have been completed in specified order and in within specified time limits?						
	Guidance	Objective Evidence	Conforming Nonconforming NA				
Do yo	u have a document (shop travelers, job sheet, etc.) that specifies all the processes for each part number/part family?	Routing tags, Load tags, and Master Tracker software data, FRGEN004 Special Parts Process Authorization	Conforming				
Defin	e the procedure that ensures that all processes have been completed in the specified order.	Routing tags, Master Tracker software process controls	Conforming				
Descr	ibe how time sensitive processes are completed in the specified time limits (e.g., hydrogen embrittlement baking).	Master Tracker process controls and user interface	Conforming				
Provid	de documentation that this process has been followed.	Master Tracker software data	Conforming				
Comn	nents:		•				
	Section 2 - Floor and Material Handling R	esponsibility					
2.7	Part loading shall be specified, documented	and controlled.					
l	i ding parameters shall be specified, documented and controlled. mples include: parts per rack, part position and orientation, weight per barrel or masking.						
	Guidance	Objective Evidence	Conforming Nonconforming NA				
Descr	ibe how the loading parameters are communicated to the operator.	Routing tags, Work instructions, Master Tracker software controls Confe					
Identi	fy how the loading weight or rack quantity is recorded for each load or rack.	Routing tags, Work instructions, Master Tracker software controls	Conforming				
Comn	nents:		•				
	Section 2 - Floor and Material Handling R	esponsibility					
2.8	There shall be a procedure for material handling, containment action and product segre	egation in the event of an unplanned process interruption.					
• Wor • Special	Inned downtime greatly increases the risk of improper processing. It instructions specifically addressing potential types of unplanned process interruptions shall be accessible to operators. Cific instructions shall address containment/reaction plans for each step of the process. Where processes are time critical, ons, current, bake or curing processes. Ience shall exist showing disposition and traceability of affected product.	immediate actions are required. Examples include process steps exposir	ng parts to: acidic				
	Guidance	Objective Evidence	Conforming Nonconforming NA				
What	procedure is used to address each step of the process?	WIHL007 Suspect Loads PRQA002 Control of Non Conforming Product FRHL001 Rework Process Tracking	Conforming				
		WIHL007 Suspect Loads					

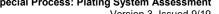



Comments:		
For part inspection, how do you arrange the lighting to avoid spot lighting, glare, shadows and distracting reflections?	Engineered lighting distribution (plant project history)	Conforming
How do you ensure the lighting in the part and/or process inspection areas, including loading and unloading areas, is adequate for the intended operation?	Engineered lighting distribution (plant project history)	Conforming
Guidance	Objective Evidence	Conforming Nonconforming NA
Lighting in the part and/or process inspection areas must be adequate for the intended operation.		
2.10 Plant lighting shall be adequate in all inspe	ction areas.	
Section 2 - Floor and Material Handling Re	esponsibility	
Comments:		
Define the process used to review the facility for conditions that are detrimental to quality processing such as chemical spills and inadequate ventilation.	WIWT011 O&MPlan NESHAP	Conforming
Describe what is done with loose parts found on the floor of the plant.	Customer specific requirements / Instructions	Conforming
Provide a copy of the procedure used to handle dropped or spilled parts.	Customer specific requirements / Instructions	Conforming
Provide a copy of the housekeeping procedure.	Employee handbook, WIWT011 O&MPlan NESHAP	Conforming
Guidance	Objective Evidence	Conforming Nonconforming NA
 Plant cleanliness, housekeeping, environmental, and working conditions shall be adequate to preserve product quality. A housekeeping policy shall be clearly defined and executed. 		
2.9 Plant cleanliness, environment, and working conditions shall be co	onducive to ensure product quality.	
Section 2 - Floor and Material Handling Ro	esponsibility	
Comments:		
	Master Tracker data	
How is the affected product traced, dispositioned and documented?	PRQA002 Control of Non Conforming Product FRHL001 Rework Process Tracking	Conforming
	WIHL007 Suspect Loads	



Section 3 - Pyrometry

Questions can be found in Process Tables A through I and shall be answered per these requirements.

P3.1 Thermocouples

- P3.1.1 Calibration of Thermocouples: Thermocouples shall be calibrated traceable to the National Institute of Standards and Technology (NIST) or other national standards laboratory prior to first use and in the temperature range in which they will be employed. The calibration temperature test points shall be no further than 150°C or 250°F apart.
- P3.1.1.1 Calibration certificates shall include the following detail: the actual test temperature reading, the nominal test temperature, the corresponding correction factor (or error/deviation value) for each calibration temperature test point, the provider of the calibration data and their accreditation symbol (or equivalent) if not performed in-house, and the calibration method used.
- P3.1.1.2 External sources providing calibrations shall be accredited to ISO/IEC 17025 or other national equivalent. Internal sources providing calibrations shall do so in accordance with the intent of ISO/IEC 17025 or other national equivalent.
- P3.1.1.3 All thermocouples shall comply with Tables P3.1.1, P3.1.2 and P3.1.3 requirements. The time interval for the replacement of thermocouples shall commence with the date thermocouple is
- P3.1.2 Reuse of Thermocouples: The date that any thermocouple is placed in service shall be documented. The tracking of uses for non-expendable control, monitoring and recording thermocouples is not required. See Tables P3.1.1, P3.1.2 and P3.1.3 for replacement and recalibration requirements.
- Damaged thermocouples shall not be used. Examples of a damaged thermocouple would include but are not limited to; insulation not intact, hot junction broken, evidence of corrosion, P3.1.2.1 crimping, termination fitting or plug has become loose or sheath material has been scratched exposing mineral insulating material.

Table P3.1.1 Calibration and Replacement Requirements for Thermocouples Used for Control, Monitoring and Recording

THERMOCOUPLE TYPE (1)	SYSTEM TYPE	CALIBRATION / REPLACEMENT INTERVAL	CALIBRATED AGAINST	INITIAL CALIBRATION ACCURACY REQUIRED
Base Metal Types (K, J, N, T)	Hydrogen Embrittlement Relief, Electroless Nickel Hardening and other Oven systems with a process temperature control tolerance of 20°C (30°F) or less	Calibrate before first use. Replace every two years (2,3)	Primary or Secondary Standard	± 1.1ºC (± 2.0ºF) or ± 0.4% whichever is greater
Base Metal Types (K, J, N, T)	Other Ovens	Calibrate before first use. Replace every four years (2,3)	Primary or Secondary Standard	± 1.1ºC (± 2.0ºF) or ± 0.4% whichever is greater
Base Metal Types (K, J, N, T)	Process Tanks	Calibrate before first use. Replace every two years (2,3)	Primary or Secondary Standard	± 1.1ºC (± 2.0ºF) or ± 0.4% whichever is greater
Noble Metal Types (B,R,S, Platinum RTD)	All Ovens and Process Tanks	Calibrate before first use. Replace or recalibrate every four years (2)	Primary or Secondary Standard	± 1.1ºC (± 2.0ºF) or ± 0.4% whichever is greater



- 1. Non-Expendable
- 2. Thermocouples shall be replaced whenever needed, e.g., failed SAT or damaged thermocouple; however, thermocouples shall be replaced minimally as stated above. Thermocouples may either be purchased calibrated or calibrated internally and shall meet requirements of P3.1.
- 3. Base metal thermocouples shall not be recalibrated.

Table P3.1.2 – Calibration and Replacement Requirements for Test Thermocouples Used for Temperature Uniformity Surveys (TUS) and System Accuracy Tests (SAT)

THERMOCOUPLE	THERMOCOUPLE TYPE	USE	CALIBRATION / REPLACEMENT INTERVAL	CALIBRATED AGAINST	CALIBRATION ACCURACY REQUIRED
Test Thermocouples	Base Metal Types (K, J, N, T)	TUS SAT	As per Table P3.1.3 Recalibration prohibited (1)	Primary or Secondary Standard	± 1.1ºC (± 2.0ºF) or ± 0.4% whichever is greater

^{1.} Base metal thermocouples shall not be recalibrated.

Table P3.1.3 - Allowable Number of Uses for Thermocouples in Specific Applications

THERMOCOUPLE TYPE	USE (1)	OPERATING TEMPERATURE	MAXIMUM PERMITTED USES
Expendable Base Metal (K, J, N, T)	Temperature Uniformity Surveys (TUS) / System Accuracy Test (SAT)	≤ 430°C (800°F)	15 (2)
Expendable Base Metal (K, J, N, T)	Control	≤ 430°C (800°F)	1 (2)
Expendable Base Metal (K, J, N, T)	Monitor/Record/Load Sensing	≤ 430°C (800°F)	30 (2)
Non-expendable Base Metal (K, J, N, T)	Temperature Uniformity Surveys (TUS) / System Accuracy Test (SAT)	≤ 430°C (800°F)	2yrs maximum
Non-expendable Base Metal (K, J, N, T)	Load Sensing (part temperature)	≤ 430°C (800°F)	6 months

^{1.} Thermocouples shall be dedicated to a specific, unalterable purpose (TUS, SAT, Load Sensing, Control, Monitoring or Recording). Thermocouples that have achieved their maximum permitted number of uses for this assigned application shall not be repurposed for other CQI-11 compliance requirements.

P3.2 Instrumentation

- P3.2.1 General Instrumentation Requirements: Instrumentation shall be calibrated traceable to the National Institute of Standards and Technology (NIST) or other national standards laboratory.
- **P3.2.1.1** External sources providing calibrations shall be accredited to ISO/IEC 17025 or other national equivalent. Internal sources providing calibrations shall do so in accordance with the intent of ISO/IEC 17025 or other national equivalent.
- P3.2.1.2 Calibration frequencies and accuracies are specified in Instrumentation Table P3.2.1.

^{2.} Under no circumstance shall any expendable base metal thermocouple be used beyond six months from date of first use.



- P3.2.1.3 The temperature for each oven control zone shall be recorded by a recording instrument. Recorder shall be operating during the entire time that product is in the oven. Process record shall be legible.
- P3.2.1.4 Analog instrumentation shall not be allowed following three (3) years from release date of this document.
- P3.2.2 Offsets: Although the use of offsets is generally discouraged, they are allowed to specifically correct for calibration errors, SAT errors or to center a TUS result.

Offset values applied are limited and shall not exceed 5°C or 10°F for the correction of instrument calibration error. An additional offset of 5°C or 10°F is allowed for the correction of an SAT error and another 5°C or 10°F of offset for the purpose of centering a TUS result.

When offsets are used a documented procedure shall exist which at a minimum describes each of the following:

- When the use of offset is permitted
- How manual (external) and electronic (internal) offsets are performed
- How the basis (calibration, SAT or TUS) for the offset is documented
- How offset is accounted for when performing calibrations
- How offset is considered when performing an SAT
- How to reintroduce any intentional offsets
- Who has the authority to approve the use of offsets
- How is this approval documented
- P3.2.3 Calibration: Calibration of control, monitoring, and recording instruments shall be performed to the manufacturer's instructions or as described in P3.2.3.1.
- P3.2.3.1 It is acceptable to perform calibrations on either a single point (measure) or multi-point (source) basis. The following requirements shall be met:
- P3.2.3.1.1 For the calibration of control, monitoring and recording instruments on oven systems and processing tanks that are in operation and running at typical operating temperatures, a single point calibration is acceptable.
- P3.2.3.1.2 Calibration of control, monitoring and recording instruments may be performed on a multi-point basis by sourcing a signal to the instrument representing the low, mid and high points of the range of the instrument.
- P3.2.3.1.3 Field Test Instruments used for the calibration of control, monitoring and recording instruments shall at a minimum meet the requirements specified in Table P3.2.1. Field Test Instrument calibration reports shall indicate correction factor or error data for each test point.
- **P3.2.3.2** For multi-channel instruments, a calibration shall be required for each channel in use.
- P3.2.4 Calibration Records: Calibration status and results shall be reported as follows:
- P3.2.4.1 A calibration label shall be affixed to the instrumentation device, or in the case of panel mounted control, monitoring or recording instrumentation, on the device or as near as practical to the device(s) to indicate the most recent successful calibration. The label(s) at a minimum shall include:
 - Date the calibration was performed
 - Due date of the next calibration
 - Technician who performed the calibration (initials are acceptable)
 - Serial number of instrument



- P3.2.4.2 Instrumentation calibration results shall be documented. The instrument calibration report or certificate shall include the following information:
 - Oven or unit identification number
 - Make, model and serial number of instrument calibrated. PLC devices/modules not serialized require unique identification. Each channel/input calibrated shall be identified
 - Standard or test instrument used during calibration
 - Method of calibration
 - Ambient temperature and humidity
 - Required accuracy (+/-2°C; +/-4°F)
 - As-Found/As-Left temperature values at each calibration point (if no adjustment is made then the final value will equal the As-Found value)
 - As-Found/As-Left offset/bias values (if no adjustment is made then the corrected offset/bias value will equal the As-Found value)
 - Basis for offset/bias values indicated and clearly defined (Calibration, SAT, or TUS)
 - Pass/Fail status
 - Any limitations or restrictions of the calibration
 - Date the calibration was performed
 - Due date of next calibration
 - Technician who performed the calibration
 - Signature of the technician who performed the calibration
 - Calibration company if not performed in-house
 - Accreditation symbol (or equivalent) if not performed in-house
 - Sign-off to include the name and title of person reviewing/approving calibration report
- P3.2.4.3 In the event of a failed calibration or out of tolerance condition, appropriate corrective actions shall be taken and documented.

Table P3.2.1 – Instrument Calibration Requirements

INSTRUMENT	INSTRUMENT TYPE	MAXIMUM CALIBRATION PERIOD (MONTHS)	CALIBRATED AGAINST	CALIBRATION ACCURACY REQUIRED	USE
Field Test Instrument	Portable potentiometer or digital instrument, electronic data recorder or data acquisition system.	12	Primary or Secondary standard	± 0.6°C (± 1.0°F) or ± 0.1% of reading	Limited to controlling, monitoring, or recording instrument calibration, performance of system accuracy tests and temperature uniformity surveys.
Control, Monitoring or Recording Instruments	Digital, Mechanical (analog), Electro- mechanical or Thermal element.	12	Field Test Instrument (single-point or multi-point calibration)	± 2.0°C (± 4.0°F)	Limited to measuring, recording, and controlling the temperature of thermal processing equipment.

- P3.3 System Accuracy Test (SAT)
- P3.3.1 Oven control, monitoring and recording temperature systems (instrument, leadwire, and thermocouple/RTD) are verified by performing an SAT. This requirement includes load sensing thermocouples. The SAT shall be performed in accordance with Section P3.3.
- **P3.3.1.1** The oven SAT frequency shall be every six months.



- P3.3.1.2 Process tank control temperature systems (instrument, leadwire, and thermocouple/RTD) are verified by performing daily (or as otherwise prescribed) temperature checks as per the applicable process table.
- P3.3.2 Oven SAT's and Process Tank daily temperature checks shall be performed using a test thermocouple conforming to the requirements of Thermocouple Table P3.1.2 coupled with a test instrument meeting the requirements of Instrumentation Table P3.2.1.
- P3.3.3 A new oven SAT shall be performed after any maintenance that could affect the SAT accuracy, e.g., the replacement of the lead wire, the control thermocouple or the replacement of the control instrument.
- P3.3.4 For oven systems the SAT shall be performed while the oven is operating at a typical operating temperature using Probe Method A as detailed in Section P3.3.4.1.
- P3.3.4.1 Probe Method A:
- P3.3.4.1.1 Probe Method A is a check between the uncorrected reading of the oven control, monitoring and recording temperature system (instrument, leadwire, and thermocouple/RTD) and the corrected reading of a test temperature system (test instrument and test thermocouple). See Illustration P3.3.1.
- P3.3.4.1.2 The tip (measuring junction) of the test thermocouple shall be no further than 50 mm (2 inches) from the tip (measuring junction) of the oven control, monitoring and recording thermocouple/RTD.
- P3.3.4.1.3 The difference between the temperature indication of the oven control, monitoring and recording instrument connected to its respective thermocouple/RTD and the corrected temperature indication of the test thermocouple on a test instrument shall be within the following tolerances:

System	Maximum SAT Difference Allowed
Ovens (all)	± 5.0°C (± 10.0°F)

After insertion of the test thermocouple, allow sufficient time to achieve equilibrium between the test thermocouple and the oven control, monitoring and recording instrument thermocouple/RTD.


P3.3.4.1.4 If the calculated SAT difference exceeds the values stated above, the appropriate corrective action shall be taken before commencing with additional processing. Oven control, monitoring or recording thermocouples/RTD's failing to meet the requirements shall be replaced.

A new SAT shall be conducted on the replacement thermocouple/RTD. Actions taken shall be documented.

Note: When using Probe Method A, any electronic offset value introduced into the control instrument for the purpose of centering a TUS result shall be included in the SAT difference calculations. See Illustration P3.3.1.

EXAMPLE of Probe Method "A"



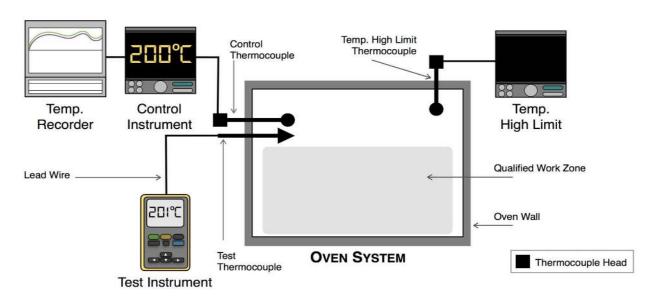

EXAMPLE of System Accuracy Test (SAT) Calculations - Probe Method A

CONTROL INSTRUMENT TEMPERATURE (A)	CONTROLLER TUS OFFSET (B)	ADJ. CONTROL INSTRUMENT TEMPERATURE (C)=(A)-(B)	TEST INSTRUMENT TEMPERATURE (D)	TEST THERMOCOUPLE CORRECTION FACTOR (E)	TEST INSTRUMENT CORRECTION FACTOR (F)	TRUE TEST TEMPERATURE (G)=(D)+(E)+(F)	CALCULATED SAT DIFFERENCE (C) – (G)
200°C	0°C	200°C	201°C	+ 0.3°C	+ 0.1°C	201.4°C	- 1.4°C
(392°F)	(0°F)	(392°F)	(394°F)	(+ 0.5°F)	(+ 0.2°F)	(394.7°F)	(- 2.7°F)

Illustration P3.3.1

P3.3.5 Oven System Accuracy Test Records shall include the following:

Version 3, Issued 9/19



- Identification of the control, monitoring or recording thermocouple being tested
- Identification of the SAT test thermocouple
- Identification of the SAT test instrument
- Date and time of day of the test
- · Observed control, monitoring or recording instrument reading
- · Observed test instrument reading
- SAT test thermocouple and SAT test instrument correction factors
- · Corrected SAT test instrument reading
- Calculated system accuracy test difference
- Pass/Fail status
- Identification of technician performing the test
- External calibration company if applicable
- Accreditation symbol (or equivalent) if not performed in-house
- Sign-off by plating organization to include the name and title of person reviewing and approving report

P3.4 Temperature Uniformity Surveys (TUS)

- P3.4.1 General TUS Requirements: Temperature uniformity characteristics, qualified work zones, and operating temperature ranges of curing ovens, electroless nickel hardening and hydrogen embrittlement relief ovens are verified by performing an annual TUS in accordance with the requirements of this section.
- P3.4.1.1 TUS's shall be performed using independent test instrumentation meeting the requirements of Table P3.2.1 Instrument Calibration Requirements and independent test thermocouples meeting the requirements of Table P3.1.2 Thermocouples.

Compensation for known deviations in the test instrumentation shall be made by electronic or mathematical corrections.

P3.4.1.2 Any oven modification or repair that could alter the temperature uniformity characteristics of the oven shall result in a temperature uniformity survey being performed prior to the oven system being used for processing.

Oven modifications are actions taken that change the oven from its original documented state. Following are examples of oven modifications that could alter the temperature uniformity characteristics of the oven and shall require an additional TUS:

- Increase in the maximum qualified operating temperature
- Decrease in the minimum qualified operating temperature
- Change in burner size, number, type or location
- Change in heating element number, type or location
- Changes to airflow (baffle positions, fan speed, fan quantity, etc.)
- Change of control sensor location
- Change of combustion pressure settings from original settings
- Temperature control scheme changes (proportional vs. high-low/on-off)
- Changes in temperature control tuning constants (PID)
- Work zone volume increase covering area not previously tested
- · Work zone location change covering area not previously tested



Oven repairs are maintenance actions that restore the oven to its original documented condition. If repairs are not expected to impact the temperature uniformity characteristics of the oven an additional TUS shall not be required. Following are examples of oven repairs that would not require an additional TUS:

- · Replacing a burner with an identical burner
- Replacing a heating element with an identical heating element
- Replacing a control thermocouple without changing its documented location
- Replacing heating system components (gas regulator, valve, metering device, etc.) with identical components and settings
- Restoring original documented combustion pressure settings
- Restoring original documented control tuning constants (PID)
- Replacing a controller with an identical controller with the same tuning constants
- System accuracy test failures
- Repair of oven door seals
- P3.4.1.3 All oven modifications or repairs shall be documented and include the determination made by the responsible authority within the organization as to whether these modifications or repairs could alter the temperature uniformity characteristics of the oven.
- P3.4.1.4 TUS Test Temperatures: Only the maximum temperature of the oven operating temperature range is required to be tested.
- P3.4.1.5 TUS Oven Parameters: When performing the temperature uniformity survey, the oven system parameters during the test shall replicate the oven system parameters during normal production.

 The preheating of the oven system is permissible if the oven is preheated in normal production.

The TUS shall be performed with a dense, full production load or simulated production load which shall represent the maximum permissible load rate for the oven during normal production. Part time to temperature shall meet the most stringent applicable customer or process specification.

P3.4.2 Continuous and Semi-Continuous Ovens

P3.4.2.1 TUS Methods: Continuous and semi-continuous ovens shall be surveyed so that the volume defined as the qualified work zone is tested. TUS test sensors shall be arranged either three dimensionally (Volumetric Method) or in a plane (Plane Method).

P3.4.2.2 Number and Location of TUS Thermocouples

P3.4.2.2.1 Volumetric Method: Shall be used with semi-continuous or pusher type ovens. See Table P3.4.1 for number of TUS thermocouples. See Figure P3.4.1 to determine appropriate location of the TUS thermocouples.

P3.4.2.2.2 Plane Method: Shall be used for continuous ovens where the product is continuously moving through the oven, e.g., belt/conveyor type ovens.

The plane method shall utilize (3) TUS thermocouples attached to or buried in the load; two of the TUS thermocouples shall be located within 50 mm (2 inches) of the work zone edges and one of the TUS thermocouples shall be located at the center.

P3.4.3 TUS Data Collection:

- P3.4.3.1 TUS test thermocouples shall be traversed through the entire oven at the maximum line speed used in production and representing all required test locations.
- P3.4.3.2 All temperature data generated by the TUS test thermocouples and all temperature data recorded on the process record for oven zone temperature shall be recorded automatically at least every thirty seconds for the duration of the survey. Data collection shall begin when the TUS test thermocouples are loaded into the oven.

The process record for oven zone temperature shall be compared to the TUS data to ensure compliance to TUS requirements. Manual data collection is not allowed.

TUS data collected shall clearly show the time elapsed between parts entering the oven and achieving target part temperature. All TUS data collected shall clearly show the time at set temperature.



P3.4.4 Batch Ovens

P3.4.4.1 TUS Methods: Batch ovens shall be surveyed so that the volume defined as the qualified work zone is tested. TUS test thermocouples shall be arranged three dimensionally (Volumetric Method) and as required in Table P3.4.1 and Figure P3.4.1.

Batch ovens shall be loaded in a single, uninterrupted and continuous process. Incremental loading, and the subsequent need to open and close batch oven doors to accommodate this loading process, is not allowed.

P3.4.4.2 Number and Location of TUS Thermocouples

P3.4.4.2.1 Volumetric Method: Shall be used with batch ovens. See Table P3.4.1 for number of TUS thermocouples. See Figure P3.4.1 for the location and placement of the TUS thermocouples.

For oven work zone volumes greater than 8.5m³ (300ft3), the thermocouple locations shall be similar to the example in Figure P3.4.1 and the additional thermocouples shall be located to best represent the qualified work zone.

P3.4.4.3 TUS Data Collection: Data collection shall begin when the TUS thermocouples are loaded into the oven.

All temperature data generated by the TUS test thermocouples and all temperature data recorded on the process record for oven zone temperature shall be recorded automatically at least every thirty seconds for the duration of the survey.

The process record for oven zone temperature shall be compared to the TUS data to ensure compliance to TUS requirements. Manual data collection is not allowed.

- P3.4.4.3.1 When the oven temperature control achieves set point temperature, displaying a normal control cycling around set point; the TUS test thermocouples have stabilized and the part time-to-temperature requirement (if applicable) has been achieved, then the TUS data collection shall continue for an additional thirty minutes minimum.
- P3.4.5 Permissible TUS Test Thermocouple Failures: A temporary condition such as a short or loose connection or other identifiable cause where normal temperature readout is restored shall not be considered a failed TUS test thermocouple.

P3.4.6 TUS Pass/Fail Requirements:

- P3.4.6.1 A temperature uniformity survey shall be acceptable if all previous requirements are met including the following:
 - Readings of all TUS thermocouples and control thermocouples are within ±10°C (±20°F) of the temperature controller set-point value or other more stringent customer specification, process sheet or technical data sheet.
 - The time required to achieve target part temperature did not exceed the time limit specified in customer specifications.
 - The required time at temperature was achieved (for continuous/semi-continuous ovens only).
 - The upper temperature tolerance was not exceeded at any time by any TUS thermocouple or temperature controller thermocouple.
 - The lower temperature tolerance was continuously maintained after reaching the beginning of the soak period.
- P3.4.6.2 Reaction to TUS Failures: If the temperature uniformity results are not within the established limits, the cause of the deviation shall be determined and documented. The equipment shall not be used for additional processing until the cause has been corrected and the TUS has been performed successfully.
- P3.4.7 TUS Report: The items listed below shall be included in the temperature uniformity survey report:




- Oven identification name or number.
- Method of TUS (whether volumetric or plane).
- Survey test temperature. (temperature controller set-point and required TUS tolerance indicated).
- TUS thermocouple quantity and location identification including a detailed diagram in three dimensional space, or detailed description of any load, rack or set-up.
- Photograph showing placement of thermocouples into the load.
- TUS thermocouple calibration report to include correction factors.
- Survey test instrument identification number.
- Survey test instrument calibration report to include calibration data and correction factors for each adjustable channel or input.
- Testing company identification (if not performed in-house).
- Accreditation symbol (or equivalent) if not performed in-house.
- Name & Signature of the technician performing the TUS.
- Survey start / stop time and start / stop date.
- Corrected readings of all TUS thermocouples at each survey temperature.
- Identify time-to-temperature for the test load.
- The data collection period or soak period.
- Control instrument tuning parameters, e.g., PID values.
- Time and temperature profile data for all TUS thermocouples and temperature control thermocouples for all zones tested. Control thermocouple data shall be generated by the associated process recorder or process data acquisition system.
- Pass/Fail status (to include indication of the applicable standard or specification).
- Summary of final plus and minus readings at each test temperature.
- Sign-off by plating organization to include the name and title of person reviewing and approving report.

Table P3.4.1 - TUS Test Thermocouple (VOLUMETRIC METHOD)

Qualified Work Zone Volume (1,2)	< 0.1 m³ (3ft³)	0.1 to 8.5m³ (3ft³ to 300ft³)
Number of Thermocouples (3)	5 (4)	9

- Note 1. For oven volumes greater than 8.5 m³ (300ft³), add at a minimum one thermocouple for each additional 3 m³ (105 ft³). For example, for a 17.50 m³ (620 ft³) oven, (12) TUS thermocouples shall be used at a minimum.
- Note 2. For bucket carriers often used in semi-continuous hydrogen embrittlement relief oven systems, (3) TUS thermocouples shall be used. Two of the TUS thermocouples shall be located within 50 mm (2 inches) of the work zone edges and one of the TUS thermocouples shall be located at the center.
- Note 3. TUS thermocouples shall be buried in the load to best represent the locations illustrated in Figure P3.4.1.
- Note 4. When (5) TUS thermocouples are required they shall be placed to represent the four corner positions and the center of a rectangular qualified work zone volume or 90° apart along the periphery and the center of a cylindrical qualified work zone volume.



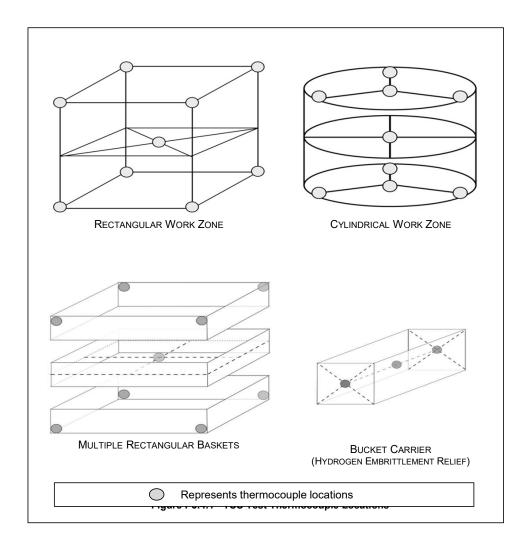



Section 4 - Plating System Assessment Job Audit - Finished Product Review

Job Identity: DT Black Chrome Exhaust Tip

Customer: Automotive

Shop Order Number: 21896

Part Number: 200000003150

Part Description: 2024 Exhaust Tip, Black Chrome

Material Substrate: Stainless Steel

Plating Requirements: Nickel 20um, Chrome 0.25um

Specification Number and Revision: PS.50022, Rev. 22-OCT-2019; PS. 50045, Rev. 07-OCT-2019

Question Number	Inspection Element	Identify Relevant Documents & Actual Condition (Provide Data or Values & Embed or Attach Documents)	Conforming Nonconforming NA
4.1	Attach evidence that the documentation for the specific part conforms to the requirements including: • Advanced quality planning process • FMEA • Process Control Plan	Project Workbook (APQP) FMEA (up-to-date) Process Control Plan (up-to-date)	Conforming
4.2	What customer specifications or requirements are used for this part? • List the specification(s) and revision(s)	FCA PS.50019, Rev. 27-NOV-2014 PS.50044, Rev. 04-AUG-2016	Conforming
4.3	Provide evidence of receiving inspection.	Part routing history	Conforming
4.4	Provide the job traveler or attach a copy of this traveler showing: Customer name Lot number Weight/quantity Process instructions Inspection requirements	Routing Tag, Fishbowl inventory tracking software information	Conforming
4.5	If the lot is divided how is the traceability maintained throughout the process?	Load IDs, Fishbowl inventory tracking software	Conforming
4.6	Describe the method used to document each operation as being completed. Is there a sign-off with time stamp, bar code or scan, etc., after each operation?	MasterTracker software with barcode scanning and time stamps at start and end of each process step	Conforming
4.7	Attach work instructions applicable to this part indicating proper barrel/basket mesh size or perforation (hole size), load size, appropriate rack configuration, appropriate part orientation on rack, etc.	Racking work instructions	Conforming
4.8	Identify each process table pertaining to this job audit. Populate the applicable process tables with the actual process results/conditions at the time this part was processed (Columns H and I in Process Tables A through H).	Process tables	Conforming
4.9	Were appropriate process steps on the job router/traveler signed off? For electronic systems, a screen print is acceptable.	MasterTracker software digital record	Conforming
4.10	Were all inspection steps, as documented in the control plan performed?	MasterTracker software digital record	Conforming
4.11	Were steps/operations performed that were not documented in the control plan?	MasterTracker software digital record	Conforming
4.12	If additional steps were performed, were they authorized?	N/A	N/A
4.13	If the order was certified, did the certification accurately reflect the process performed?	Plating Certification	Conforming
4.14	Was the certification signed by an authorized individual?	Plating Certification	Conforming
4.15	Are the parts and containers free of foreign objects or contamination?	General Operational procedure	Conforming



Question Number	Inspection Element	Identify Relevant Documents & Actual Condition (Provide Data or Values & Embed or Attach Documents)	Conforming Nonconforming NA
4.16	Are packaging requirements identified?	APQP / Project Workbook, Packing instructions	Conforming
4.17	Are parts packaged to prevent mixing or damage to parts (parts packed over height of container)?	Packaging work instructions	Conforming
4.18	Are storage condition sufficient to maintain part quality. e.g., parts are stored indoors in a clean, dry environment.	Warehouse and Production Plant	Conforming
4.19	Were the parts properly identified and/or labeled before shipping?	Labeling instructions, color coded labels for good, rework, scrap	Conforming
4.20	For the finished part, list each test and inspection requirement per customer specification.	Each part may have one or more requirements determined specification. Parts must meet each requirement. Add additional sections as needed.	d by the plating
	Below is an <u>example</u> of how to fill out sections in 4.20.x	Inspection Requirement	Conforming Nonconforming NA
	Test Description:	Corrosion Resistance	
	Test Method:	ASTM B117	
	Test frequency or quantity:	daily, 2 parts	Conforming
only	Test Requirement:	240 hrs. no white / 1000 hours no red	
	Result: Attach evidence:	White corrosion at 168 hours, no red LAB Report 12	Nonconforming
	Insert audit data below this line. Add additional sections as nee	ded.	
	Test Description:	Plating Thickness	
	Test Method:	ASTM B764	
4.20.1	Test frequency or quantity:	Bi-weekly, 1 part	Conforming
	Test Requirement:	Minimum Nickel 20 μm, Chrome 0.25 μm	
	Result: Attach evidence:	Pass. Nickel 26.17 um, Chrome 0.26 um Test completed on 6/3/25. QA Master testing log	Conforming
	Test Description:	Resistance to Corrosion	
	Test Method:	ASTM B368 CASS Test, 3x22 hrs.	
	Test frequency or quantity:	Quarterly	Conforming
4.20.2	Test Requirement:	No surface defects or corrosion on all significant surfaces	
	Result: Attach evidence:	Pass. No surface defects or corrosion on significant surfaces. Test completed 5/5/25.	Conforming



PROCESS TABLE A - Zinc & Zinc Alloy Plating

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

For multiple tanks that serve the same purpose copy and paste sections as needed.

Columns H and I are used for the Job Audit (Section 4).

Regularly scheduled measurements (e.g., temperature, concentrations, pH) are to be entered in the appropriate row.

For sections that are not applicable mark NA in the Comments column.

Process Line Identification: N/A

Type of Line: Rack or Barrel

	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit I	Measurements
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
1.0	Alkaline Cleaning							
	Type - Spray - Soak - Electro (anodic or cathodic)					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
A1.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify daily.		NA		
A1.2	Concentration	Manual		Once per day.		NA		
A1.3	Time	Automatic		After any program changes.		NA		
A1.4	Agitation (if applicable)	Automatic		Once every 8 hours.		NA		
A1.5	Amperage or Voltage Control (if applicable)	Automatic		Once every 8 hours*.		NA		
A1.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
A1.7	Impurity Content Check Per chemical supplier recommendation such as: - acid split (oil contamination) - alkalinity ratio	Manual		Once per week*		NA		
A1.8	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
A1.9	Ultrasonic (if applicable functionality check)	Manual		Once every 8 hours.		NA		
2.0	Acid Pickling							
	Туре:					NA		



	Category/Process Steps	Type of Con	itrol	Monitoring Frequency		Observation/ Comments	Job Audit I	Measurements
ITEM#		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
	Size, volume:					NA		
	Chemical supplier:					NA		
A2.1	Temperature (Thermocouple) (if applicable)	Automatic Max SAT difference allowed +/- 3°C (5°F).		Continuous monitoring by controller. Manually verify daily.		NA		
A2.2	Concentration	Manual		Once every 8 hours*		NA		
A2.3	Metallic impurity concentration. Obtain metallic impurity limits from chemical supplier with required corrective actions.	Manual		Once per month.		NA		
A2.4	Time (Less than 10 Minutes or Customer Specific)	Automatic		After any program changes.		NA		
A2.5	Inhibitor	Manual		Per Control Plan.		NA		
A2.6	Solution Level	Manual		Once every 8 hours.		NA		
A2.7	Flowing Rinse	Automatic		Once every 8 hours.		NA		
A2.8	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
3.0	Acid Plating Bath							
	Type:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
A3.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).		Continuous monitoring by controller. Manually verify daily.		NA		
A3.2	Time	Automatic		After any program changes.		NA		
A3.3	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
A3.4	Current/Voltage	Automatic or Manual		Once every 8 hours.		NA		
A3.5	Chloride Concentration	Manual		Once per day.		NA		
A3.6	рН	Manual		Once every 8 hours.		NA		
A3.7	Plating Test Cell (Hull Cell)	Manual		Once per day.		NA		
A3.8	Plating Metal Concentration(s)	Manual		Once per day*.		NA		
A3.9	Alloying Element Concentration (e.g., Ni, Co, Sn; if applicable)	Manual		Once per day.		NA		
A3.10	Metallic impurity concentration. Obtain metallic impurity limits from chemical supplier with required corrective actions.	Manual		Once per month.		NA		
A3.11	Buffer (Ammonia / Boric Acid/Acetate per TDS)	Manual		Once per month.		NA		
A3.12	Filtration Pressure	Continuous		Once every 8 hours.		NA		
A3.13	Agitation (Rack only - others optional)	Continuous		Once every 8 hours.		NA		



	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit I	Measurements
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
A3.14	Proprietary chemical additives concentration (e.g., wetter, carrier, brightener)	Manual		Once per month by Supplier.		NA		
A3.15	Chemical feeders	Automatic		Once per week.		NA		
A3.16	Fallen part removal	Manual		As per preventive maintenance schedule.		NA		
A3.17	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
4.0	Alkaline Plating Bath							•
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
A4.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).		Continuous monitoring by controller. Manually verify daily.		NA		
A4.2	Time	Automatic or Manual		Automatic - After any program changes. Manual - every load.*		NA		
A4.3	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
A4.4	Current/Voltage	Automatic or Manual		Once every 8 hours.		NA		
A4.5	Plating Test Cell (Hull Cell)	Manual		Once per day.		NA		
A4.6	Zinc Generator Tank (if applicable) -Caustic Concentration -Zinc Concentration	Automatic or Manual		Once every 8 hours.		NA		
A4.7	Caustic Concentration	Manual		Once per day.		NA		
A4.8	Zinc Concentration	Manual		Once per day.		NA		
A4.9	Alloying Element Concentration (e.g., Fe, Ni, Co; if applicable)	Manual		Once per day.		NA		
A4.10	Complexor Concentration (for alloy baths)	Manual		Once per month by Supplier.		NA		
A4.11	Metallic impurity concentration. Obtain metallic impurity limits from chemical supplier with required corrective actions.	Manual		Once per month.		NA		
A4.12	Carbonate (CO ₃) concentration	Manual		Once per month (Twice per month for alloy plating).		NA		
A4.13	Proprietary chemical additives concentration (e.g., carrier, brightener)	Manual		Once per month by Supplier.		NA		
A4.14	Chemical feeders	Automatic		Once per week.		NA		
A4.15	Agitation (Rack only - others optional)	Continuous		Once every 8 hours.		NA		
A4.16	Cathode Rod Agitation (if applicable)	Automatic		Once every 8 hours.		NA		
A4.17	Filtration Pressure	Continuous		Once every 8 hours.		NA		



	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit M	l leasurements
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
A4.18	Fallen part removal	Manual		Rack: Once every 24 hours. Barrel: Once per week and after any lost load.		NA		
A4.19	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
5.0	Pre-bake acid treatment if baking is required (i.e., nitric, sulfuric, chromate, etc.)							
A5.1	pH/concentration	Manual		Once every 8 hours.		NA		
A5.2	Time	Automatic		After any program changes.		NA		
A5.3	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
6.0	Hydrogen Embrittlement Relief							
A6.1	Refer to PT Embrittlement Bake as required					NA		
7.0	Acid Activation (i.e., nitric, sulfuric, etc.)							
A7.1	pH/concentration	Manual		Once every 8 hours.		NA		
A7.2	Time	Automatic*		After any program changes.		NA		
A7.3	Fallen part removal	Manual		Once every 24 hours for rack line.		NA		
A7.4	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
8.0	Rinse (This section is to be repeated as necessary to doc process line. In cases of sequential rinses this section co							
A8.1	Rinse Type - Identify in comment section e.g., Flowing, Counter Flowing, Spray, Stagnant, Drag-in/out, etc.	NA		NA		NA		
A8.2	Water Type- Identify in comment section e.g., Municipal, Deionized (DI),Reverse Osmosis (RO), etc.	NA		NA		NA		
A8.3	Agitation type - Identify in comment section (if applicable) e.g., Mechanical (Describe), Air, Ultrasonic, etc.	NA		NA		NA		
A8.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
A8.5	Temperature (Thermocouple) (if applicable)	Automatic Max SAT difference allowed +/- 3°C (5°F).		Once every 8 hours.		NA		
A8.6	Rinse Quality - Identify in comment section e.g., pH, Impurity Check, Conductivity	Manual		Once every 8 hours.*		NA		
A8.7	Flow rate (if applicable)	Manual		Once every 8 hours.		NA		
A8.8	Spray nozzle condition (if applicable)	Manual		Once every 8 hours.		NA		
A8.9	Verify position of incoming water feed is near the bottom (if immersion tank).	Manual		Per preventive maintenance program.		NA		
A8.10	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		



	Category/Process Steps	Type of Cor	itrol	Monitoring Frequency		Observation/ Comments	Job Audit	Measurements
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
9.0	Passivates							
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
A9.1	Concentration	Automatic or Manual		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
A9.2	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).		Continuous monitoring by controller. Manually verify daily.		NA		
A9.3	Time	Automatic or Manual		Automatic - After any program changes. Manual - every load.*		NA		
A9.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
A9.5	рН	Automatic*		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
A9.6	Agitation	Automatic		Once every 8 hours.		NA		
A9.7	Metallic Impurity level(s) (e.g., Fe, Zn)	Manual		Once per week.		NA		
A9.8	Filtration if applicable	Automatic		Once every 8 hours.		NA		
A9.9	Fallen part removal	Manual		Once every 24 hours for rack line.		NA		
A9.10	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
10.0	Supplemental Treatments - Topcoats, Sealants and Friction	on Modifiers						
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
A10.1	Concentration	Manual		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
A10.2	Temperature (Thermocouple) (if applicable)	Automatic Max SAT difference allowed +/- 1°C (2°F).		Continuous monitoring by controller. Manually verify daily.		NA		
A10.3	pH (if applicable)	Automatic or Manual		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
A10.4	Time	Automatic*		After any program changes if automatic.		NA		
A10.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
A10.6	Filtration Pressure (if applicable)	Automatic		Once every 8 hours.		NA		



	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit I	Measurements
ITEM#		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
A10.7	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
11.0	Drying							
A11.1	Drying Time	Automatic		Per Process Sheet and TDS.		NA		
A11.2	Drying Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Per Process Sheet and TDS.		NA		
A11.3	Verify operation of blowers and/or rotation of dryer.	Manual		Once per 8 hours.		NA		
A11.4	There is a procedure to ensure dryness of parts.	Manual		Every container and rack.		NA		
12.0	Process Equipment							
A12.1	Process equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.							
	Guidance			Objective Evidence / Comments				
	the internal system used for conducting and managing calibrated in Table I?	tion of all relevant equipment						NA
Provide	the document that lists all relevant equipment identified in Pro	cess Table I.						NA
How do	you ensure calibrations are up to date?							NA
	you ensure new equipment has been added to the calibration en removed?	list, and inactive equipment						NA
Are cali	ibration labels present and up to date for listed equipment?							NA
What is	the reaction plan to any failed verification?							NA
A12.2	Barrels, baskets, and drive mechanism shall be maintained. Verifications shall be performed against a certified standard ar	nd data recorded.						
	Guidance			Objective Evidence / Comm	ents			Conforming Nonconforming NA
(i.e., pe	you inspect for the integrity of the barrels, baskets, and drive ruforations, trap points, warpage, plugged holes, door gaps, other are the inspection results documented?							NA
Describ	Describe your preventive maintenance program for barrels, baskets and drive mechanism.							NA
How is	each barrel and basket uniquely identified for tracking purposes	s?						NA
A12.3	Racks and fixtures shall be maintained. Organization shall have preventive maintenance system that i	s documented and implemente	ed.					•
	Guidance			Objective Evidence / Comm	ents			Conforming Nonconforming NA



	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit I	Measurements		
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit		
(i.e., bro	you inspect for the integrity of the racks and fixtures? ken electrical contacts, plating build up, plastisol rack coating a are the inspection results documented?	ind other damage)								
Describe	e your preventive maintenance program for racks and fixtures.							NA		
How is e	each rack or fixture identified for tracking purposes?							NA		
A12.4	Rectifiers shall be maintained. The Plater shall have a preventive maintenance system that is	documented and implemente	d.							
•	Guidance			Objective Evidence / Comm	ents			Conforming Nonconforming NA		
	e the preventive maintenance program for rectifiers used in pro tage, amperage and ripple).	duction and in the laboratory						NA		
-	pple reading within the maximum allowable limit recommended	by the chemical supplier?						NA		
A12.5 All Anodes, Contacts and Bussing shall be maintained. Organization shall have preventive maintenance system that is documented and implemented.										
	Guidance			Objective Evidence / Comments						
	e the preventive maintenance program for anodes of all types in askets and auxiliary.	ncluding inert, consumable,						NA		
	e the preventive maintenance program for contacts and electric ess, high electrical resistance, electrical shorts.	cal bussing including						NA		
	All filters shall be maintained. The organization shall have a preventive maintenance system	that is documented and imple	mented.							
'	Guidance			Objective Evidence / Comm	ents			Conforming Nonconforming NA		
Describe and cart	e the preventive maintenance program for all plating solution fil ridge.	ters to include plate, filter bag						NA		
	e the preventive maintenance program for all air filters used on and fans etc.	ovens, dryers, chillers,						NA		
A12.7	All process and equipment alarms shall be tested on a quarter The organization shall have a preventive maintenance system	ly basis at a minimum. that is documented and imple	mented.							
	Guidance		Objective Evidence / Comments					Conforming Nonconforming NA		
	e the preventive maintenance program where alarms are used cooling, level control, air circulation and air agitation etc.	for amperage, voltage,						NA		
Provide	a list of all the alarms that are tested and the test frequency.							NA		
A12.8	All process equipment including the tanks have a maintenance	schedule that is documented	and followed.							



	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit	Measurements
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
	Guidance			Objective Evidence / Comm	ents			Conforming Nonconforming NA
associa (i.e., Ta	The preventive maintenance schedule should include a list of equipment that is in use with the issociated process. i.e., Tanks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level incredit in circulation and air agitation etc.)							NA
	e the method used to develop and document the maintenance nted, electronic)	schedule.						NA
Provide	an example of a completed sign off record.							NA
13.0	Test Equipment							
Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.								Conforming
	Guidance			Objective Evidence / Comments				
Wet An Before	alysis: use, chemicals must be checked for shelf life and/or expiration	date.						NA
pH / Co	onductivity Meter							NA
pH / Co	onductivity Probes							NA
lon Sele	ective probes are optional.							NA
Dedicat	ted probes must be used for chromates / passivates.							NA
Laborat	tory Balance (Weight Scale) (Optional)							NA
Atomic	Absorption (AA) or Inductively Coupled Plasma (ICP)							NA
X-Ray F	Fluorescence (XRF) - Optional for Zinc Plating, Required for Zin	c Alloy Plating						NA
Lab Re	ctifier							NA
Hand h	eld thermometer							NA
Pipettes	s - Before use, pipettes must be checked for broken tips							NA
Salt Sp	ray Cabinet							NA
Thickne	ess Tester							NA
Lab Ov	en							NA
Torque-	Torque-tension/Friction Tester - Required for fastener plating only.							NA
Procee	d to PT - H Embrittlement Bake (if required)							



PROCESS TABLE B - Mechanical Plating

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

For multiple tanks that serve the same purpose copy and paste sections as needed.

Columns H and I are used for the Job Audit (Section 4).

Regularly scheduled measurements (e.g., temperature, concentrations, pH) are to be entered in the appropriate row.

For sections that are not applicable mark NA in the Comments column.

Process Line Identification:

Process Barrel size:

	Category/Process Steps	Type of Cor	ntrol	Monitoring Frequency		Observation/ Comments	Job Audit I	Measurements
ITEM#		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
1.0	Cleaning/Conditioning in Mechanical Plating Barrel							
	Type:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
B1.1	Time	Manual		Per load		NA		
B1.2	Rotation Speed	Manual		Per load		NA		
B1.3	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
B1.4	Load Size (weight and surface area)	Manual		Per load		NA		
B1.5	Water Volume	Manual		Per load		NA		
B1.6	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).		Per load		NA		
B1.7	Media Mix (Ratio) Verification by operator the bead size and mix is correct.	Manual		Per load		NA		
B1.8	Media (Load Volume)	Manual		Per load		NA		
B1.9	Media Cleanliness (To Avoid Contamination)	Manual		Once per week.		NA		
B1.10	Surface Conditioner (Volume or weight)	Manual		Per load		NA		
B1.11	Surface Conditioner (Time)	Manual		Per load		NA		
B1.12	If off-line cleaning is not used, multiple cycles of surface conditioner shall be repeated, with appropriate decant processes.	Manual		Per load		NA		
B1.13	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
2.0	Mechanical Plating							
	Type:					NA		



	Size, volume: Chemical supplier:			NA	
	Chemical supplier:				
B2.1 V	·			NA	
	Water Volume	Manual	Per load	NA	
B2.2 1	Automatic Temperature (Thermocouple) (if applicable) Automatic Max SAT difference al +/- 3°C (5°F).		Per load	NA	
B2.3	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
	Media Mix (Ratio) Verification by operator the bead size and mix is correct.	Manual	Per load	NA	
B2.5	Surface preparation (Volume or weight) - Cu Flash	Manual	Per load	NA	
B2.6	Surface preparation (Time)	Manual	Per load	NA	
B2.7 S	Surface condition (copper) visual inspection	Manual	Per load	NA	
B2.8 F	Promoter(s) (Weight)	Manual	Per load	NA	
B2.9	Promoter (Time)	Manual	Per load	NA	
B2.10 Z	Zinc Flash (Volume or weight)	Manual	Per load	NA	
B2.11 Z	Zinc Slurry Concentration (when added as measured volume)	Manual	Prior to the start of production and once per shift.	NA	
B2.12 Z	Zinc Flash (Time)	Manual	Per load	NA	
B2.13	Metal Addition (Volume or weight)	Manual	Per load	NA	
	Metal Slurry Concentration Addition (when added as measured volume)	Manual	Prior to the start of production and once per shift.	NA	
B2.15	Metal Addition (Number of Additions)	Manual	Per load	NA	
	pH adjustments Confirm pH is being maintained	Manual	Before each addition.	NA	
B2.17	Metal Thickness (Alloy, if applicable)	Manual	Per load	NA	
B2.18 V	Water Polish (time)	Manual	Per load	NA	
B2.19 F	Part/Media Separation	Manual	Per load	NA	
B2.20 V	Water Discharge to water treatment	Manual	Per load	NA	
	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
3.0 F	Passivates (Off line)				
1	Туре:				
	Size, volume:			NA	
	Chemical supplier:			NA	
B3.1	Concentration	Automatic or Manual	Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.	NA	
B3.2 1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Automatic - Continuous monitoring by controller and manually verify daily. Manual - every load.*	NA	
B3.3 1	Time	Automatic or Manual	Automatic -After any program changes. Manual - every load.*	NA	
	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	



B3.5	рН	Automatic or Manual		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
B3.6	Agitation	Automatic or Manual		Per load		NA		
B3.7	Metallic Impurity level(s) (e.g., Fe, Zn)	Manual		Once per week.		NA		
B3.8	Rinse	Automatic or Manual		Once every 8 hours.		NA		
B3.9	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
4.0	Supplemental Treatments - Sealers and Torque Tension Modifiers							
	Type:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
B4.1	Concentration	Automatic or Manual		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
B4.2	Automatic Max SAT difference allowed +/- 3°C (5°F).			Automatic - Continuous monitoring by controller and manually verify daily. Manual - every load.*		NA		
B4.3	Time	Automatic or Manual		Automatic -After any program changes. Manual - every load.*		NA		
B4.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
B4.5	рН	Automatic or Manual		Prior to production start-up. If automatic control, once per day. If manual, once every 8 hours.		NA		
B4.6	Filtration (if applicable)	Automatic		Once per day.		NA		
B4.7	Filtration Pressure (if applicable)	Manual		Once per day.		NA		
B4.8	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
5.0	Drying							
B5.1	Drying Time	Automatic/Manual		Per Process Sheet and TDS.		NA		
B5.2	Drying Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Per Process Sheet and TDS.		NA		
B5.3	Verify operation of blowers and/or rotation of dryer.	Manual		Once every 8 hours.		NA		
B5.4	There is a procedure to ensure dryness of parts.	Manual		Every container.		NA		
6.0	Process Equipment							
B6.1	Process equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.							
	Guidance			Objective Evidence / Comm	ents			Conforming Nonconforming NA
	the internal system used for conducting and managing calibrated in Process Table I?	ition of all relevant equipment						NA
Provide	the document that lists all relevant equipment identified in Pro	ocess Table I.						NA
How do	you ensure calibrations are up to date?							NA



How do you ensure new equipment has been added to the calibration list, and inactive equipment has been removed?		NA
Are calibration labels present and up to date for listed equipment?		NA
What is the reaction plan to any failed verification?		NA
Barrels, baskets, and drive mechanism shall be maintained. Organization shall have preventive maintenance system that is documented and implemente	ad.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
How do you inspect for the integrity of the barrels, baskets, and drive mechanism? (i.e., perforations, trap points, warpage, plugged holes, door gaps, other damage) Where are the inspection results documented?		NA
Describe your preventive maintenance program for barrels, baskets and drive mechanism.		NA
How is each barrel and basket uniquely identified for tracking purposes?		NA
86.3 All process and equipment alarms shall be tested on a quarterly basis at a minimum. The organization shall have a preventive maintenance system that is documented and imple	emented.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program where alarms are used for amperage, voltage, heating, cooling, level control, air circulation and air agitation etc.		NA
Provide a list of all the alarms that are tested and the test frequency.		NA
B6.4 All process equipment including the tanks have a maintenance schedule that is documented	and followed.	•
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
The preventive maintenance schedule should include a list of equipment that is in use with the associated process. There shall be a completion sign off record. Examples: Tanks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level control, air circulation and air agitation etc.		NA
7.0 Test Equipment		1
B7.1 Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.		
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Wet Analysis: Before use, chemicals must be checked for shelf life and/or expiration date.		NA
pH / Conductivity Meter		NA
pH / Conductivity Probes		NA
on Selective probes are optional.		NA
Dedicated probes must be used for chromates / passivates.		NA
position produce must be used for simematics / passivation.		
<u> </u>		NA
Laboratory Balance (Weight Scale) (Optional) Atomic Absorption (AA) or Inductively Coupled Plasma (ICP) (Optional)		NA NA



Pipettes - Before use, pipettes must be checked for broken tips	NA
Salt Spray Cabinet	NA
Thickness Tester	NA
Lab Oven (Optional)	NA
Torque-tension/Friction Tester - Optional for fastener plating.	NA



PROCESS TABLE C - Decorative Plating of Metal Substrates

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

Columns H and I are used for the Job Audit (Section 4).

Regularly scheduled measurements (e.g., temperature, concentrations, pH) are to be entered in the appropriate row.

Hoist Line

For sections that are not applicable mark NA in the Comments column.

Process Overview

Provide complete process flow sequence:

- For example:
- 1. Soak cleaner
- 2. Electrocleaner
- 3. Rinse
- 4. Rinse
- 5. Continue as required

Process Line Identification:

Type of Line: Rack or Barrel/Hoist or Return Type

Observation/ **Job Audit Measurements** Category/Process Steps Type of Control **Monitoring Frequency** Comments Conforming **Actual Measurements** ITEM# Minimum Requirement **Actual Condition** Minimum Requirement **Actual Condition** Nonconforming Range supporting time of Job NA Audit 1.0 Polishing and Buffing Both manual and Type: (Manual or Automatic) automatic Check which metals are applicable: C1.1 Steel: Yes Incoming inspection C1.2 Stainless Steel: Yes Incoming inspection C1.3 Aluminum: No C1.4 Zinc die cast: Yes Incoming inspection C1.5 Other (identify): Brass Incoming inspection Alkaline Cleaning 3.0 Type Spray Soak & Electro - Soak - Electro (anodic or cathodic) Size, volume: Chemical supplier: Continuous monitoring by Automatic controller. See TrueChem Max SAT difference allowed C3.1 Temperature (Thermocouple) Continuous monitoring by controller. Manually verify daily. Pass Pass Manually verified software +/- 5°C (10°F). on each production shift



C3.2	Concentration	Manual	Once per day.	Once per day	Pass	See TrueChem	Pass
C3.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C3.4	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C3.5	Amperage or Voltage Control- if applicable.	Automatic	Once every 8 hours*.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C3.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C3.7	Impurity Content Check Per chemical supplier recommendation such as: - acid split (oil contamination) - alkalinity ratio.	Manual	Once per week*	See chem supplier TDS	Pass	N/A	Pass
C3.8	Ultrasonic (if applicable functionality check).	Manual	Once every 8 hours.	N/A	Pass	N/A	Pass
C3.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem records	Pass
5.0	Acid						
	Type:						
	Size, volume:						
	Chemical supplier:						
C5.1	Temperature (Thermocouple) (if applicable)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Operated at room temperature	Pass	See TrueChem	Pass
C5.2	Concentration	Manual	Once every 8 hours*.	Once per day	Pass	See TrueChem	Pass
C5.3	Time (Per Specification)	Automatic	After any program changes.	After any recipe change.	Pass	Min. time set in software	Pass
C5.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		Pass	Reviewed visual indicators	Pass
C5.5	Impurity Content Check Per chemical supplier recommendation.	Manual	Once per week*.	See chem supplier TDS	Pass	N/A	Pass
C5.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem records	Pass
6.0	Electrolytic Strike, Immersion, or Electroless Deposits						
	Type:						
	Size, volume:						
	Chemical supplier:						
C6.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified on each production shift.	Pass	See TrueChem	Pass
C6.2	pH (if applicable)	Manual	Once every 8 hours*.	N/A		See TrueChem	Pass
C6.3	Concentration	Manual	Once per day.	One per day	Pass	See TrueChem	Pass
C6.4	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C6.5	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C6.6	Amperage or Voltage Control- if applicable	Automatic	Once every 8 hours*.	Continuous monitoring by	Pass	See OMS recipes	Pass



C6.7	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C6.8	Impurity Content Check Per chemical supplier recommendation.	Manual	Once per week*.	Monthly	Pass	See TrueChem	Pass
C6.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem records	Pass
7.0	Acid Copper (if applicable)						
	Туре:						
	Size, volume:						
	Chemical supplier:						
C7.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified on each production shift.	Pass	See TrueChem	Pass
C7.2	Concentration(s)	Manual	Once per day*.	Once per day	Pass	See TrueChem	Pass
C7.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C7.4	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C7.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C7.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C7.7	Filtration	Continuous	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C7.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem records	Pass
8.0	Copper Activation						
C8.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Room temperature	Pass	See TrueChem	Pass
C8.2	Concentration(s)	Manual	Once per day*.	Daily	Pass	TrueChem	Pass
C8.3	Time	Automatic	 After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C8.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C8.5	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C8.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem records	Pass
9.0	Semi-Bright Nickel						
	Туре:						
	Size, volume:						
	Chemical supplier:						



C9.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified on each production shift.	Pass	See TrueChem	Pass
C9.2	Concentration(s)	Manual	Once per day*	Once per day	Pass	See TrueChem	Pass
C9.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C9.4	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C9.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C9.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C9.7	рН	Manual	Once every 8 hours.	Once per shift	Pass	See TrueChem	Pass
	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	Once per month	Pass	See TrueChem records	Pass
C9.9	Ductility test	Manual	Once per month.	Once per month	Pass	See TrueChem	Pass
C9.10	Sulfur Concentration (as deposited).	Manual	Once per month.	Once per month	Pass	See TrueChem	Pass
C9.11	Filtration	Continuous	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C9.12	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
10.0	High Activity Nickel (if applicable)	_					
	Туре:						
	Size, volume:						
	Chemical supplier:						
C10.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified daily.	Pass	See TrueChem	Pass
C10.2	Concentration(s)	Manual	Once per day*.	Once per day	Pass	See TrueChem	Pass
C10.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C10.4	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C10.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C10.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C10.7	рН	Manual	Once every 8 hours.	Once per shift	Pass	See TrueChem	Pass
	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	Once per month	Pass	See TrueChem records	Pass
C10.9	Filtration	Continuous	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C10.10	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
11.0	Bright Nickel						



	Туре:						
	Size, volume:						
	Chemical supplier:						
C11.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified daily.	Pass	See TrueChem	Pass
C11.2	Concentration(s)	Manual	Once per day*.	Once per day	Pass	See TrueChem	Pass
C11.3	Time	Automatic	After any program changes.	After any recipe changes	Pass	Min. time set in software	Pass
C11.4	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C11.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C11.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C11.7	рН	Manual	Once every 8 hours.	Once per shift	Pass	See TrueChem	Pass
C11.8	Ductility test	Manual	 Once per month.	Once per month	Pass	See TrueChem	Pass
C11.9	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	Once per month	Pass	See TrueChem records	Pass
C11.10	Filtration	Continuous	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C11.11	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
12.0	Satin/Specialty Nickel (if applicable)						
	Type:						
	Size, volume:						
	Chemical supplier:						
C12.1	Process Type - Identify in comment section e.g., Batch or Continuous (for Satin nickel).			Continuous	Pass	See gloss records sheet	Pass
C12.2	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Once every 8 hours.	Continuous monitoring by controller. Manually verified daily.	Pass	See TrueChem	Pass
C12.3	Concentration(s)	Manual	Per chemical supplier recommendation.	Once per day	Pass	See TrueChem	Pass
C12.4	Appearance verification per OEM Master Standard or OEM Certified Production part.	Manual	Once every 4 hours.	Every production load	Pass	See gloss records sheet	Pass
C12.5	Time	Automatic	 After any program changes.	After any recipe changes	Pass	Min. time set in software	Pass
C12.6	Agitation	Automatic	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C12.7	Current/Voltage	Automatic	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C12.8	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C12.9	рН	Manual	 Once every 8 hours.	Once per shift	Pass	See TrueChem	Pass



		1		1	1	1	1
C12.10	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	Once per month	Pass	See TrueChem records	Pass
C12.11	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
13.0	Microporous Nickel/Nobel Nickel (if applicable)						
	Туре:						
	Size, volume:						
	Chemical supplier:						
C13.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified daily.	Pass	See TrueChem	Pass
C13.2	Concentration(s)	Manual	Once per day*.	Once per week	Pass	See TrueChem	Pass
C13.3	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	Once per month	Pass	See TrueChem records	Pass
C13.4	Solids/Pore Count (For Microporous)	Manual	Once per day*.	Daily	Pass	TrueChem	Pass
C13.5	Filter out and recharge solids (For Microporous)	Manual	Once per week.	Once per week	Pass	See TrueChem	Pass
C13.6	Organic contamination removal (For Microporous)	Manual	Once per week*.	Once per week	Pass	See TrueChem	Pass
C13.7	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C13.8	Agitation	Automatic	Per process sheet.	Once per shift	Pass	See checklist	Pass
C13.9	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C13.10	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C13.11	рН	Manual	Once every 8 hours.	Once per shift	Pass	See TrueChem	Pass
C13.12	STEP Test (of final product)	Manual	Once per day*.	Once per day	Pass	See QA STEP log	Pass
C13.13	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
14.0	Hexavalent Chromium						
	Type:						
	Size, volume:						
	Chemical supplier:						
C14.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified daily.	Pass	See TrueChem	Pass
C14.2	Concentration(s)	Manual	Once every 4 hours*	Once per day	Pass	See TrueChem - all in spec	Pass
C14.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C14.4	Agitation (if applicable)	Automatic	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C14.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass



C14.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C14.7	Impurity Content Check Per chemical supplier recommendation e.g., metallic contamination.	Manual	Once per month.	Once per month	Pass	See TrueChem records	Pass
C14.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
15.0	Trivalent Chromium			l	'	1	
	Туре:						
	Size, volume:						
	Chemical supplier:						
C15.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.	Continuous monitoring by controller. Manually verified daily.	Pass	See TrueChem	Pass
C15.2	Concentration(s)	Manual	Once every 4 hours*.	Once per week	Pass	See TrueChem - all in spec	Pass
C15.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C15.4	Agitation (if applicable)	Automatic	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C15.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C15.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass
C15.7	Impurity Content Check Per chemical supplier recommendation e.g., Metallic contamination.	Manual	Once per week*.	Once per month	Pass	See TrueChem records	Pass
C15.8	Appearance verification per OEM Master Standard or OEM Certified Production part.	Manual	Once every 8 hours.	Each load	Pass	See appearance review records	Pass
C15.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	TrueChem	Pass	See TrueChem	Pass
16.0	Chromium Post Treatment (if applicable)						
	Type:						
	Size, volume:						
	Chemical supplier:						
C16.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Once every 8 hours.	Once per shift	Pass	See TrueChem	Pass
C16.2	Concentration(s)	Manual	Once per week*.	once per day	Pass	See TrueChem	Pass
C16.3	Time	Automatic	After any program changes.	After any recipe change	Pass	Min. time set in software	Pass
C16.4	Agitation (if applicable)	Automatic	Once every 8 hours.	Once per shift	Pass	See checklist	Pass
C16.5	Current/Voltage (if applicable)	Automatic	Once every 8 hours.	Continuous monitoring by plating software	Pass	See OMS recipes	Pass
C16.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	Once per shift	Pass	Reviewed visual indicators	Pass



The preventive maintenance program. Touchem Pass See TrucChem Storons			
Special Continues Process line		hem Pass	
Process like. In case of sequential rinses this section covers the final rinse of the sequence) Process like. In case of sequential rinses settins of counter Flowing, Spray, Stagmant, Drag-riout, NA NA NA Counter Flowing, Spray, Stagmant, Drag-riout, NA NA Counter Flowing, Spray, Stagmant, Drag-riout, NA NA NA Counter Flowing, Spray, Stagmant, Drag-riout, NA NA NA Counter Flowing, Spray, Stagmant, Drag-riout, NA NA NA Counter Flowing, Spray, Stagmant, Na Na Counter F	ion maintena	hem Pass	
GFF. A commentation of the process o			
e.g., Municipal, Denoined (DI), Reverse comosts (RO), etc. 4.2.4.3. Aplation, Npe.: Identify in comment section (if applicable) Agg. Mechanical (Decorbe), Ar. (Unisonic, etc. 4.2.4.4.5. Parts. Notestrs, and transducers are completely submerged. Automatic 4.2.4.6. Parts. Notestrs, and transducers are completely submerged. Automatic 4.2.4.6. Parts. Notestrs, and transducers are completely submerged. Automatic 6.2.4.6. Rinse Quality: Identify in comment section (a.g., pH. Impurity Cheek, Conductivity. 6.2.4.7. For varie (if applicable) 6.2.4.7. For varie (
c.g., Mechanical (Describe), Air, Ultrasonic, etc. 1. Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controller. Manually verify daily for automatic controls, every 8 hours for systems without controller. The pass Reviewed visual indicators of the pass of the	entify in com , Deionized (
Solution Lever Parks Newbers, and transducers are completely submerged Automatic CH7-6 Parks Newbers, and transducers are completely submerged Automatic CH7-6 Temperature (Thermocouple) (if applicable) Automatic Automatic CH7-6 Temperature (Thermocouple) (if applicable) Automatic Automatic CH7-7 Parks Nas Guality - Identify in comment section e.g., pH, Impurity Check, Conductivity. Annual Once every 8 hours. Once every 8 hours. Once per shift Pass See TrueChem Pass See TrueChem Once every 8 hours. Once per shift Pass See TrueChem Once every 8 hours. Once per shift Pass See TrueChem Pass See aniant Training materials CH7-10 Pass See aniant Training materials CH7-10 Pass See TrueChem Pass See TrueC	Identify in co al (Describe),		
## See TrueChem ## See TrueChe	s, and transdu	visual Pass	
Geg. pH, Impurity Check, Conductivity. Geg. pH, Impurity Check, Conductivity. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (if applicable). Manual Geg. Geg. Flow rate (if applicable). Geg. Geg. Flow rate (Thermocouple	hem Pass	
C-17-8 Spray nozzle condition (if applicable). Manual Once every 8 hours. Once per shift Pass See checklist C-17-9 Verify position of incoming water feed is near the bottom (if Immersion tank). C-17-9 Verify position of incoming water feed is near the bottom (if Immersion tank). C-17-10 Individual Per preventive maintenance program. At install or tank modification Pass See maint. Training materials C-17-10 Tank and solution maintenance schedule documented and Manual Per preventive maintenance program. TrueChem Pass See TrueChem Individual Control of the Pass See TrueChem Individual Control of the Pass See TrueChem Individual Control of the Pass See OMS recipes Individual Control of the Pass See Checklist Individual Contr		hem Pass	
Verify position of incoming water feed is near the bottom (if mmersion tank).	plicable).	es Pass	
Manual Per preventive maintenance program. modification Pass Training materials	ondition (if ap	list Pass	
49.0 Drying C18-1 Drying Time Automatic A		aterials Pass	
C-18.4 Drying Time Automatic Per Process Sheet and TDS. Continuous monitoring by plating software plating so	ion maintena	hem Pass	
C18-2 Drying Temperature (Thermocouple) Automatic Per Process Sheet and TDS. Automatic Per Process Sheet and TDS. Automatic Pass See CMS recipes plating software Automatic Pass See Checklist Pass See checklist Pass See checklist Visual review of each load @ Prelinspect inspect Pass See pre-inspect checklist Process Equipment Process Equipment Process Equipment shall be verified and calibrated per Process Table I. Calibrations shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Cultivations shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Cultivations shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Cultivations and managing calibration of all relevant equipment. Complete the audit for these identified and managing calibration of all relevant equipment. Politic epilitation less.			
G18-2 Drying Temperature (Thermocouple) Max SAT difference allowed +/- 5°C (10°F). C18-3 Verify operation of blowers and/or rotation of dryer. Manual Once per 8 hours. Once per 8 hours. Once per 8 hours. Visual review of each load @ Preinspect checklist Every container and rack. Pass See checklist Visual review of each load @ Preinspect checklist 49.0 Process Equipment Process equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. Automatic Pass See checklist Visual review of each load @ Preinspect checklist Pass See pre-inspect checklist Objective Evidence / Comments What is the internal system used for conducting and managing calibration of all relevant equipment. Pass See checklist Once per 8 hours. Pass See checklist Visual review of each load @ Preinspect checklist Visual review of each load @ Preinspect checklist Objective Evidence / Comments		ecipes Pass	
C18.4 There is a procedure to ensure dryness of parts. Manual Every container and rack. Visual review of each load @ Prelinspect checklist Process Equipment Process Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Guidance Objective Evidence / Comments What is the internal system used for conducting and managing calibration of all relevant equipment. Digital calibration per	ature (Therm	list Pass	
C18.4 There is a procedure to ensure dryness of parts. Manual Every container and rack. Every container and rack. each load @ Pre- load @ Pre- checklist Process Equipment Process equipment shall be verified and calibrated per Process Table I. Calibrations shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Guidance Objective Evidence / Comments What is the internal system used for conducting and managing calibration of all relevant equipment. Digital collaboration load.	of blowers	list Pass	
Process equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Guidance Objective Evidence / Comments What is the internal system used for conducting and managing calibration of all relevant equipment. Digital calibration less.	edure to ens	spect Pass	
Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Guidance Objective Evidence / Comments What is the internal system used for conducting and managing calibration of all relevant equipment. Digital calibration log	ment		
What is the internal system used for conducting and managing calibration of all relevant equipment Digital calibration log	all be certifie be used to tr		
	Guidance		
		Conforming	
Provide the document that lists all relevant equipment identified in Process Table I. Digital calibration log	nat lists all rel	Conforming	
How do you ensure calibrations are up to date? Digital schedule with reminders	orations are ι	Conforming	



How do you ensure new equipment has been added to the calibration list, and inactive equipment has been removed?	QA Team responsible for Gage Log management	Conforming
Are calibration labels present and up to date for listed equipment?	Yes	Conforming
What is the reaction plan to any failed verification?	Re-verification, re-calibration if necessary	Conforming
C19.2 Barrels, baskets, and drive mechanism shall be maintained. Verifications shall be performed against a certified standard and data recorded.		
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
How do you inspect for the integrity of the barrels, baskets, and drive mechanism? (i.e., perforations, trap points, warpage, plugged holes, door gaps, other damage) Where are the inspection results documented?	All barrel and drive mechanism maintenance is tracked thru our work order database. All maintenance findings and inspection notes are updated in the work order comments by the tech performing the work. All barrels are test run on the line before being put back into production.	Conforming
Describe your preventive maintenance program for barrels, baskets and drive mechanism.	Operators inspect and report equipment integrity as needed via standard work order process, proper operation is reviewed on every run of every barrel	Conforming
How is each barrel and basket uniquely identified for tracking purposes?	Number labels on the sides of barrels. These are referenced in TrueChem and maintenance records	Conforming
C19.3 Racks and fixtures shall be maintained. Organization shall have preventive maintenance system that is documented and implement	ed.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
How do you inspect for the integrity of the racks and fixtures? (i.e., broken electrical contacts, plating build up, plastisol rack coating and other damage) Where are the inspection results documented?	Inspected and documented at pre-inspect, a tooling repair database is used for all internal tooling maintenance performed.	Conforming
Describe your preventive maintenance program for racks and fixtures.	Managed by MasterTracker software, which allows only preset number of uses before maintenance. A tooling repair database used to track maintenance performed	Conforming
How is each rack or fixture identified for tracking purposes?	ID on each rack	Conforming
C19.4 Rectifiers shall be maintained. The Plater shall have a preventive maintenance system that is documented and implemente	rd.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for rectifiers used in production and in the laboratory (i.e., voltage, amperage and ripple).	PMs are defined in PM database and referenced in Rectifier PM.docx.	Conforming
Is the ripple reading within the maximum allowable limit recommended by the chemical supplier?	Yes	Conforming
All Anodes, Contacts and Bussing shall be maintained. Organization shall have preventive maintenance system that is documented and implement	ed.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for anodes of all types including inert, consumable, bags, baskets and auxiliary.	TrueChem schedule drives maintenance for soluble anodes and bags. Insoluble anodes and baskets are inspected during pump out and replaced / repaired if damaged or worn beyond our specified tolerances.	Conforming
Describe the preventive maintenance program for contacts and electrical bussing including cleanliness, high electrical resistance, electrical shorts.	Running loads in current control will elevate the voltage to keep the current where needed. Upon approaching the maximum voltage the rectifier will alarm and the rectifier / bussing will be evaluated	Conforming
C19.6 All filters shall be maintained. The organization shall have a preventive maintenance system that is documented and imple	emented.	•
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for all plating solution filters to include plate, filter bag and cartridge.	TrueChem schedule drives filter maintenance including carbon additions, filter paper changes, tube or cartidge replacement, acid leeching of filter plates, etc.	Conforming
Describe the preventive maintenance program for all air filters used on ovens, dryers, chillers, blowers and fans etc.	PM system in place for Air fliter replacement of equipment	Conforming



C19.7	All process and equipment alarms shall be tested on a quarterly basis at a minimum. The organization shall have a preventive maintenance system that is documented and imple	mented.			
	Guidance	Objective Evidence / Comments	Conforming Nonconforming NA		
	e the preventive maintenance program where alarms are used for amperage, voltage, , cooling, level control, air circulation and air agitation etc.	Alarms happen when errors occur on the automation that runs the plating line, The error is corrected and the alarm is silenced by the plating staff. The errors are reviewed weekly and mainttnance schedules are adjusted	Conforming		
Provide	a list of all the alarms that are tested and the test frequency.	Each switch status is tested everytime a hoist moves, incorrect switch status triggers the event alarms	Conforming		
C19.8	All process equipment including the tanks have a maintenance schedule that is documented	and followed.			
	Guidance	Objective Evidence / Comments	Conforming Nonconforming NA		
associa (i.e., Ta	ventive maintenance schedule should include a list of equipment that is in use with the ted process. nks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level air circulation and air agitation etc.)	Maintenance schedule is split between the TrueChem system and the maintenance preventative maintenance system, depending on what the item is.	Conforming		
	e the method used to develop and document the maintenance schedule. nted, electronic)	Electronic	Conforming		
Provide	an example of a completed sign off record.	See TrueChem records or digital preventative maintenance records	Conforming		
20.0	Test Equipment				
C20.1	Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.				
	Guidance	Objective Evidence / Comments	Conforming Nonconforming NA		
Wet An Before	alysis: use, chemicals must be checked for shelf life and/or expiration date.	Chemical expiration log - up-to-date and nothing expired currently.	Conforming		
oH / Co	nductivity Meter	Not required per manufacturer. Probe calibration only before each use	Conforming		
oH / Co	nductivity Probes	Logged digitally on pH meter itself	Conforming		
Solution	n compatible probes must be used.	Probes are designed for plating solutions	Conforming		
_aborat	ory Balance (Weight Scale) (Optional)	Last calibrated 11/18/24	Conforming		
Atomic	Absorption (AA) or Inductively Coupled Plasma (ICP)	Calibrated before each use. Unit will not display ppm results without new calibration	Conforming		
K-Ray F	Fluorescence (XRF) (Optional)	Last Calibrated 10/29/24	Conforming		
ab Re	ctifier	Last Calibrated 11/12/24	Conforming		
Hand h	eld thermometer	Disposed of annually. Log of date in service held by quality lab	Conforming		
Pipettes	s - Before use, pipettes must be checked for broken tips	Checked all pipette tips - none broken	Conforming		
CASS	Cabinet	Last Calibrated 11/12/24	Conforming		
Thickne	ess Tester	Last Calibrated 11/19/24	Conforming		
_ab Ov	en	Last Calibrated 5/14/25	Conforming		
Vicrosc	ope (Min 100X) with calibrated grid reticle for Pore/Crack Count	Last Calibrated 3/19/25			
reezer		N/A			



PROCESS TABLE D - Decorative Plating of Plastic Substrates

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

Columns H and I are used for the Job Audit (Section 4).

Regularly scheduled measurements (e.g., temperature, concentrations, pH) are to be entered in the appropriate row.

For sections that are not applicable mark NA in the Comments column.

Process Overview

Provide complete process flow sequence:

For example:

- 1. Cleaning and Pre-Etch (If Applicable)
- 2. Etch
- 3. Rinse
- 4. Rinse
- 5. Neutralizer
- 6. Continue as required

Process Line Identification:

Type of Line: Rack or Barrel/Hoist or Return Type

	Category/Process Steps	Type of Cont	rol	Monitoring Frequency		Observation/ Comments Job Aud		it Measurements	
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit	
1.0	Cleaning and Pre-Etch (If Applicable)						•		
	Туре:					NA			
	Size, volume:					NA			
	Chemical supplier:					NA			
D1.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify once every 4 hours.		NA			
D1.2	Concentration	Manual		Once every 8 hours*.		NA			
D1.3	Time	Automatic		After any program changes.		NA			
D1.4	Agitation	Automatic		Per process sheet.		NA			
D1.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA			
D1.6	Solution and tank clean out schedule is documented and followed - Desludging, new make-up frequency, etc.	Manual		Per preventive maintenance program.		NA			



				ı	1	 ,
D1.7	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA	
2.0	Etch					
	Туре:				NA	
	Size, volume:				NA	
	Chemical supplier:				NA	
D2.1		Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify once every 4 hours.		NA	
D2.2	Concentration	Manual	Once every 8 hours*.		NA	
D2.3	Verify operation of the Trivalent chromium regeneration system (Porous Pot, Membrane, Reoxidation) such as amperage, voltage, and solution flow per Process Control Plan.	Manual	Once every 8 hours.		NA	
D2.4	Impurity Content Check (Trivalent Chromium) Per chemical supplier recommendation.	Manual	Once per week*.		NA	
D2.5	Time	Automatic	After any program changes.		NA	
D2.6	Agitation	Automatic	Per process sheet.		NA	
D2.7	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA	
D2.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA	
3.0	Neutralizer					
	Туре:				NA	
	Size, volume:				NA	
	Chemical supplier:				NA	
D3.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.		NA	
D3.2	Concentration	Manual	Once every 8 hours*.		NA	
D3.3	Time	Automatic	After any program changes.		NA	
D3.4	Agitation	Automatic	Per process sheet.		NA	
D3.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA	
D3.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA	
4.0	Activator					
	Туре:				NA	
	Size, volume:				NA	
	Chemical supplier:				NA	
D4.1		Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify once every 4 hours.		NA	
		` '				



D4.3	Time	Automatic	After any program changes.	NA	
D4.4	Agitation (if applicable)	Automatic	Per process sheet.	NA	
D4.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
D4.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
5.0	Conductor (if applicable for direct metallization)	·			
	Туре:			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
D5.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify once every 4 hours.	NA	
D5.2	Concentration	Manual	Once every 8 hours*.	NA	
D5.3	Time	Automatic	After any program changes.	NA	
D5.4	Agitation	Automatic	Per process sheet.	NA	
D5.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
D5.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program	NA	
6.0	Accelerator				
	Туре:			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
D6.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify once every 4 hours.	NA	
D6.2	Concentration	Manual	Once every 8 hours*	NA	
D6.3	Time	Automatic	After any program changes.	NA	
D6.4	Agitation	Automatic	Per process sheet.	NA	
D6.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
D6.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
7.0	Electroless Plating (if applicable)				
	Туре:			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
D7.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify once every 4 hours.	NA	
D7.2	Concentration	Manual	Once every 4 hours.	NA	
	o chi continuation		· ·		



D7.4	Time	Automatic	After any program changes.	NA.	A		
D7.5	Agitation	Automatic	Per process sheet.	N/	A		
D7.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	N.A	A		
D7.7	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	A		
8.0	Activation						
	Type:			N/	A		
	Size, volume:			N/	A		
	Chemical supplier:			N/	A		
D8.1	Concentration	Manual	Once every 8 hours*	N/	A		
D8.2	Time	Automatic	After any program changes.	N/	A		
D8.3	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	N.A	A		
D8.4	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	A		
9.0	Immersion Plate (if applicable)			•	•		
	Туре:			N/	A		
	Size, volume:			N/	A		
	Chemical supplier:			N/	A		
D9.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify once every 4 hours.	N.A	A		
D9.2	Concentration	Manual	Once every 4 hours	N/	A		
D9.3	Time	Automatic	After any program changes.	N/	A		
D9.4	Agitation	Automatic	Per process sheet.	N/	A		
D9.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	N.A	A		
D9.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	N.A	A		
10.0	Electrolytic Plating - Strike (if applicable)				•	<u>'</u>	
	Туре:			N/	A I		
	Size, volume:			N/	A		
	Chemical supplier:			N/	A		
D10.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify every 4 hours.	N.A	A		
D10.2	Concentration	Manual	Once per day.	N.A	A		
D10.3	pH (if applicable)	Manual	Once every 8 hours*.	N.A	A		
D10.4	Current/Voltage	Automatic or Manual	Once every 8 hours.	N.A	A		
D10.5	Time	Automatic	After any program changes.	N.A	A		
D10.6	Agitation	Automatic	Per process sheet.	N.A	A		
	l ~		'	1.0			



D10.7	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	1	NA	
D10.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	1	NA	
11.0	Acid Copper (if applicable)	·				
	Туре:			1	NA	
	Size, volume:			1	NA	
	Chemical supplier:			1	NA	
D11.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	1	NA	
D11.2	Concentration(s)	Manual	Once per day*.		NA	
D11.3	Time	Automatic	After any program changes.	1	NA	
D11.4	Agitation	Automatic	Per process sheet.	1	NA	
D11.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	1	NA	
D11.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	1	NA	
D11.7	Filtration	Continuous	Once every 8 hours.	1	NA	
D11.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	1	NA	
12.0	Copper Activation					
D12.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	1	NA	
D12.2	Concentration(s)	Manual	Once per day*.	1	NA	
D12.3	Time	Automatic	After any program changes.	1	NA	
D12.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	1	NA	
D12.5	Agitation	Automatic	Per process sheet.	1	NA	
D12.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	1	NA	
13.0	Semi-Bright Nickel					
	Туре:			1	AV	
	Size, volume:			1	NA	
	Chemical supplier:			1	AV	
D13.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	1	NA	
D13.2	Concentration(s)	Manual	Once per day*	1	NA	
	Time	Automatic	After any program changes.	1	NA	
D13.3	Tillie					
	Agitation	Automatic	Per process sheet.	1	NA	



D13.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by contautomatic controls, every 8 ho controllers.	troller. Manually verify daily for urs for systems without	NA	
D13.7	рН	Manual	Once every 8 hours.		NA	
D13.8	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.		NA	
D13.9	Ductility test	Manual	Once per month.		NA	
D13.10	Sulfur Concentration (as deposited)	Manual	Once per month.		NA	
D13.11	Filtration	Continuous	Once every 8 hours.		NA	
D13.12	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance p	orogram.	NA	
14.0	High Activity Nickel (if applicable)	'		•	<u>'</u>	
	Туре:				NA	
	Size, volume:				NA	
	Chemical supplier:				NA	
D14.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by continuous	troller. Manually verify daily.	NA	
D14.2	Concentration(s)	Manual	Once per day*.		NA	
D14.3	Time	Automatic	After any program changes.		NA	
D14.4	Agitation	Automatic	Per process sheet.		NA	
D14.5	Current/Voltage	Automatic or Manual	Once every 8 hours.		NA	
D14.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by contautomatic controls, every 8 ho controllers.	troller. Manually verify daily for urs for systems without	NA	
D14.7	рН	Manual	Once every 8 hours.		NA	
D14.8	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.		NA	
D14.9	Filtration	Continuous	Once every 8 hours.		NA	
D14.10	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance p	rogram.	NA	
15.0	Bright Nickel					
	Туре:				NA	
	Size, volume:				NA	
	Chemical supplier:				NA	
D15.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by continuous	troller. Manually verify daily.	NA	
D15.2	Concentration(s)	Manual	Once per day*.		NA	
D15.3	Time	Automatic	After any program changes.		NA	
D15.4	Agitation	Automatic	Per process sheet.		NA	
D15.5	Current/Voltage	Automatic or Manual	Once every 8 hours.		NA	
D15.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by contautomatic controls, every 8 ho controllers.	troller. Manually verify daily for urs for systems without	NA	



D45.7	L-11	Manual	0	INIA	I	I
D15.7	•	Manual	Once every 8 hours.	NA		
D15.8	Ductility test	Manual	Once per month.	NA		
D15.9	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	NA		
D15.10	Filtration	Continuous	Once every 8 hours.	NA		
D15.11	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
16.0	Satin/Specialty Nickel (if applicable)				•	
	Туре:			NA		
	Size, volume:			NA		
	Chemical supplier:			NA		
D16.1	Process Type - Identify in comment section e.g., Batch or Continuous (for Satin Nickel).			NA		
D16.2	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Once every 8 hours.	NA		
D16.3	Concentration(s)	Manual	 Per chemical supplier recommendation.	NA		
D16.4	Appearance verification per OEM Master Standard or OEM Certified Production part.	Manual	Once every 4 hours.	NA		
D16.5	Time	Automatic	After any program changes.	NA		
D16.6	Agitation	Automatic	Once every 8 hours.	NA		
D16.7	Current/Voltage	Automatic	Once every 8 hours.	NA		
D16.8	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		
D16.9	рН	Manual	Once every 8 hours.	NA		
D16.10	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	NA		
D16.11	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
17.0	Microporous Nickel/Nobel Nickel (if applicable)					
	Туре:			NA		
	Size, volume:			NA		
	Chemical supplier:			NA		
D17.1	Temperature (Thermocouple)	Automatic. Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	NA		
D17.2	Concentration(s)	Manual	Once per day*.	NA		
D17.3	Impurity Content Check Per chemical supplier recommendation e.g., Total Organic Contamination, metallic contamination.	Manual	Once per month.	NA		
D17.4	Solids/Pore Count (For Microporous)	Manual	Once per day*.	NA		
D17.5	Filter out and recharge solids (For Microporous)	Manual	Once per week.	NA		
D17.6	Organic contamination removal (For Microporous)	Manual	Once per week*.	NA		
D17.7	Time	Automatic	After any program changes.	NA		
D17.8	Agitation	Automatic	Per process sheet.	NA		
D17.0	Current/Voltage	Automatic or Manual	Once every 8 hours.	NA		



	1	,			1	ı	1	
D17.10	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	_	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
D17.11	pH	Manual		Once every 8 hours.		NA		
D17.12	STEP Test (of final product)	Manual		Once per day*.		NA		
D17.13	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
18.0	Hexavalent Chromium							
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
D18.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).		Continuous monitoring by controller. Manually verify daily.		NA		
D18.2	Concentration(s)	Manual		Once every 4 hours*		NA		
D18.3	Time	Automatic		After any program changes.		NA		
D18.4	Agitation (if applicable)	Automatic		Once every 8 hours.		NA		
D18.5	Current/Voltage	Automatic or Manual		Once every 8 hours.		NA		
D18.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
D18.7	Impurity Content Check Per chemical supplier recommendation e.g., metallic contamination.	Manual		Once per month.		NA		
D18.8	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
19.0	Trivalent Chromium							
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
D19.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).		Continuous monitoring by controller. Manually verify daily.		NA		
D19.2	Concentration(s)	Manual		Once every 4 hours*.		NA		
D19.3	Time	Automatic		After any program changes.		NA		
D19.4	Agitation (if applicable)	Automatic		Once every 8 hours.		NA		
D19.5	Current/Voltage	Automatic or Manual		Once every 8 hours.		NA		
D19.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
-								
D19.7	Impurity Content Check Per chemical supplier recommendation e.g., Metallic contamination.	Manual		Once per week*.		NA		
D19.7	Per chemical supplier recommendation	Manual Manual		Once per week*. Once every 8 hours.		NA NA		
	Per chemical supplier recommendation e.g., Metallic contamination. Appearance verification per OEM Master Standard or OEM			•				
D19.8	Per chemical supplier recommendation e.g., Metallic contamination. Appearance verification per OEM Master Standard or OEM Certified Production part. Tank and solution maintenance schedule documented and	Manual		Once every 8 hours.		NA		
D19.8	Per chemical supplier recommendation e.g., Metallic contamination. Appearance verification per OEM Master Standard or OEM Certified Production part. Tank and solution maintenance schedule documented and followed.	Manual		Once every 8 hours.		NA		



	Chemical cumplion			1	NΑ	
	Chemical supplier:	Automotio			NA	
D20.1	Temperature (Thermocouple)	Automatic. Max SAT difference allowed +/- 3°C (5°F).	Once every 8 hours.		NA	
D20.2	Concentration(s)	Manual	Once per week*.		NA	
D20.3	Time	Automatic	After any program changes.		NA	
D20.4	Agitation (if applicable)	Automatic	Once every 8 hours.		NA	
D20.5	Current/Voltage (if applicable)	Automatic	Once every 8 hours.		NA	
D20.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA	
D20.7	Impurity Content Check Per chemical supplier recommendation.	Manual	Once per week*.		NA	
D20.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA	
21.0	Rinse (This section is to be repeated as necessary to door process line. In cases of sequential rinses this section co					
D21.1	Rinse Type - Identify in comment section e.g., Flowing, Counter Flowing, Spray, Stagnant, Drag-in/out, etc.	NA	NA		NA	
D21.2	Water Type- Identify in comment section e.g., Municipal, Deionized (DI),Reverse Osmosis (RO), etc.	NA	NA		NA	
D21.3	Agitation type - Identify in comment section (if applicable) e.g., Mechanical (Describe), Air, Ultrasonic, etc.	NA	NA		NA	
D21. 4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA	
D21.5	Temperature (Thermocouple). (if applicable)	Automatic	Once every 8 hours.		NA	
D21.6	Rinse Quality - Identify in comment section e.g., pH, Impurity Check, Conductivity.	Manual	Once every 8 hours.*		NA	
D21.7	Flow rate (if applicable)	Manual	Once every 8 hours.		NA	
D21.8	Spray nozzle condition (if applicable)	Manual	Once every 8 hours.		NA	
D21.9	Verify position of incoming water feed is near the bottom (if immersion tank).	Manual	Per preventive maintenance program.		NA	
D21.10	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA	
22.0	Drying					
D22.1	Drying Time	Automatic	Per Process Sheet and TDS.		NA	
D22.2	Drying Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Per Process Sheet and TDS.		NA	
D22.3	Verify operation of blowers and/or rotation of dryer.	Manual	 Once per 8 hours.		NA	
D22.4	There is a procedure to ensure dryness of parts.	Manual	Every container and rack.		NA	
23.0	Process Equipment			•	•	
D23.1	Process equipment shall be verified and calibrated per Proces Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment Complete the audit for these identified elements in Process Ta					





Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
What is the internal system used for conducting and managing calibration of all relevant equipment identified in Process Table I?		NA
Provide the document that lists all relevant equipment identified in Process Table I.		NA
How do you ensure calibrations are up to date?		NA
How do you ensure new equipment has been added to the calibration list, and inactive equipment has been removed?		NA
Are calibration labels present and up to date for listed equipment?		NA
What is the reaction plan to any failed verification?		NA
Post Racks and fixtures shall be maintained. Organization shall have preventive maintenance system that is documented and implemented	d.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
How do you inspect for the integrity of the racks and fixtures? (i.e., broken electrical contacts, plating build up, plastisol rack coating and other damage) Where are the inspection results documented?		NA
Describe your preventive maintenance program for racks and fixtures.		NA
How is each rack or fixture identified for tracking purposes?		NA
Rectifiers shall be maintained. The Plater shall have a preventive maintenance system that is documented and implemented	ı.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for rectifiers used in production and in the laboratory (i.e., voltage, amperage and ripple).		NA
Is the ripple reading within the maximum allowable limit recommended by the chemical supplier?		NA
All Anodes, Contacts and Bussing shall be maintained. Organization shall have preventive maintenance system that is documented and implemented	d.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for anodes of all types including inert, consumable, bags, baskets and auxiliary.		NA
Describe the preventive maintenance program for contacts and electrical bussing including cleanliness, high electrical resistance, electrical shorts		NA
All filters shall be maintained. The organization shall have a preventive maintenance system that is documented and impler	mented.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for all plating solution filters to include plate, filter bag and cartridge		NA
Describe the preventive maintenance program for all air filters used on ovens, dryers, chillers, blowers and fans etc.		NA
All process and equipment alarms shall be tested on a quarterly basis at a minimum. The organization shall have a preventive maintenance system that is documented and impler	mented.	



Conforming Guidance Objective Evidence / Comments Nonconforming NA Describe the preventive maintenance program where alarms are used for amperage, voltage, NA heating, cooling, level control, air circulation and air agitation etc. Provide a list of all the alarms that are tested and the test frequency. NA D23.7 All process equipment including the tanks have a maintenance schedule that is documented and followed. Conforming Guidance Objective Evidence / Comments Nonconforming NA The preventive maintenance schedule should include a list of equipment that is in use with the associated process. NA (i.e., Tanks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level control, air circulation and air agitation etc.) Describe the method used to develop and document the maintenance schedule. NA (i.e., printed, electronic) Provide an example of a completed sign off record. NA 24.0 Test Equipment Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. D24.1 A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I. Conforming Nonconforming Guidance Objective Evidence / Comments NA Wet Analysis: NA Before use, chemicals must be checked for shelf life and/or expiration date. pH / Conductivity Meter NA pH / Conductivity Probes NA Solution compatible probes must be used. NA Laboratory Balance (Weight Scale) (Optional) NA Atomic Absorption (AA) or Inductively Coupled Plasma (ICP) NA X-Ray Fluorescence (XRF) (Optional) NA NA Lab Rectifier Hand held thermometer NA Pipettes - Before use, pipettes must be checked for broken tips NA CASS Cabinet NA Thickness Tester NA Lab Oven NA Microscope (Min 100X) with calibrated grid reticle for Pore/Crack Count NA NA Freezer Spectrophotometer NA



PROCESS TABLE E - Electropolish and Chrome Flash

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

Process Table E is designed to cover multiple types of decorative Electropolish and Chrome Flash on Stainless Steel processes. Included are sections for each basic category/process step. The assessor is responsible to identify each process step/tank in the Process Overview section below. In addition, the assessor must copy and insert the corresponding audit detail section into the table below to create a full representation of every step of the process being audited.

Columns H and I are used for the Job Audit (Section 4).

Regularly scheduled measurements (e.g., temperature, concentrations, pH) are to be entered in the appropriate row.

For sections that are not applicable mark NA in the Comments column.

Process Overview

Provide complete process flow sequence:

For example:

- 1. Electropolish
- 2. Rinse
- 3. Chromium Plate
- 4. (Continue as required)

Process Line Identification:

	I	Т				I	1	
	Category/Process Steps	Type of Control Monitoring Frequency Observation/ Comments			Job Audit Measurements			
ITEM #	•	Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
1.0	Polishing and Buffing						NA	
	Type: (Manual or Automatic)						NA	
	Check which metals are applicable:						NA	
E1.1	Steel:						NA	
E1.2	Stainless Steel:						NA	
E1.3	Aluminum:						NA	
E1.4	Zinc die cast:						NA	
E1.5	Other (identify):						NA	
2.0	Precleaning (Vapor Degrease/Solvent/Immersion Cleaning/ Biological Cleaning)							
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
<u>€2.1</u>	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify daily.		NA		
E2.2	Concentration	Manual		Once per day.		NA		
E2.3	Time	Automatic		After any program changes.		NA		

62



E2.5 Solution	Juliution Level Parts, heaters, and transducers are completely submerged. purity Content Check or chemical supplier recommendation. prasonic (if applicable functionality check) Ink and solution maintenance schedule documented and lowed. permediate Alkaline Cleaning-Soak or Electrocleaning modic or Cathodic) pe: pe: pe: pe: pe: pe: pemical supplier: mperature (Thermocouple)	Automatic Automatic or Manual Manual Manual Manual Automatic Automatic Max SAT difference allowed +/- 5°C (10°F).	Per process sheet. Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers. Once per week*. Once every 8 hours. Per preventive maintenance program.	NA	
E2.6 Impu Per c E2.7 Ultra E2.8 Tank follov 3.0 Inter (Anc Type Size Chei E3.1 Tem E3.2 Conce E3.3 Time	Parts, heaters, and transducers are completely submerged. purity Content Check or chemical supplier recommendation. prasonic (if applicable functionality check) nk and solution maintenance schedule documented and lowed. permediate Alkaline Cleaning-Soak or Electrocleaning modic or Cathodic) pe: pe: pe. pe. pemical supplier: mperature (Thermocouple)	Manual Manual Manual Automatic Max SAT difference allowed +/- 5°C (10°F).	automatic controls, every 8 hours for systems without controllers. Once per week*. Once every 8 hours. Per preventive maintenance program.	NA NA NA NA	
E2.8 Tank follow 3.0 Inter (Anc Type Size Chei E3.1 Tem E3.2 Concess.3 Times	r chemical supplier recommendation. trasonic (if applicable functionality check) nk and solution maintenance schedule documented and lowed. termediate Alkaline Cleaning-Soak or Electrocleaning nodic or Cathodic) pe: te, volume: temical supplier: mperature (Thermocouple)	Manual Manual Automatic Max SAT difference allowed +/- 5°C (10°F).	Once every 8 hours. Per preventive maintenance program.	NA NA NA	
E2.8 Tank follow 3.0 Inter (Anc (Anc Cheir E3.1 Tem) E3.2 Conc E3.3 Times	nk and solution maintenance schedule documented and lowed. termediate Alkaline Cleaning-Soak or Electrocleaning modic or Cathodic) pe: ze, volume: termical supplier: mperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Per preventive maintenance program.	NA NA NA	
3.0 Inter (And Type Size Chei	lowed. remediate Alkaline Cleaning-Soak or Electrocleaning modic or Cathodic) pe: ze, volume: lemical supplier: Imperature (Thermocouple) Incentration me	Automatic Max SAT difference allowed +/- 5°C (10°F).		NA NA	
(And Type Size Cher E3.1 Temp E3.2 Cond E3.3 Time	nodic or Cathodic) pe: ze, volume: nemical supplier: mperature (Thermocouple) oncentration ne	Max SAT difference allowed +/- 5°C (10°F).		NA	
Size Chei E3.1 Tem E3.2 Conc E3.3 Time	ze, volume: nemical supplier: mperature (Thermocouple) nocentration ne	Max SAT difference allowed +/- 5°C (10°F).		NA	
E3.1 Tem E3.2 Cond E3.3 Time	mperature (Thermocouple) encentration	Max SAT difference allowed +/- 5°C (10°F).			
E3.1 Tem E3.2 Cond E3.3 Time	mperature (Thermocouple) oncentration ne	Max SAT difference allowed +/- 5°C (10°F).		NA	ļ
E3.2 Cond	oncentration ne	Max SAT difference allowed +/- 5°C (10°F).		ı	
E3.3 Time	ne	Manual	Continuous monitoring by controller. Manually verify daily.	NA	
			Once per day.	NA	
E3.4 Agita		Automatic	After any program changes.	NA	
	itation	Automatic	Per process sheet.	NA	
E3.5 Amp	nperage or Voltage Control - if applicable	Automatic	Once every 8 hours*.	NA	
	lution Level Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
E3.7 Per o	purity Content Check r chemical supplier recommendation such as: cid split (oil contamination) Ikalinity ratio.	Manual	Once per week*	NA	
€3.8 Ultra	rasonic (if applicable functionality check)	Manual	Once every 8 hours.	NA	
	nk and solution maintenance schedule documented and lowed.	Manual	Per preventive maintenance program.	NA	
4.0 Clea	eaning Conditioning Steps			•	
Туре	pe:			NA	
Size	ze, volume:			NA	
Chei	nemical supplier:			 NA	
E4.1 Tem	mperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify daily.	NA	
E4.2 Cond	ncentration	Manual	Once every 8 hours*.	NA	
E4.3 Time	ne	Automatic	After any program changes.	NA	
€4.4 Agita	itation	Automatic	Per process sheet.	NA	
€4.5 Amp	nperage or Voltage Control	Automatic	Once every 8 hours*.	NA	
	olution Level Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
	nk and solution maintenance schedule documented and lowed.	Manual	Per preventive maintenance program.	NA	
5.0 Acid	id				



7	Type:				NA		
	Size, volume:				NA		
	Chemical supplier:				NA		
	Temperature (Thermocouple) (if applicable)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.		NA		
€5.2	Concentration	Manual	Once every 8 hours*.		NA		
€5.3	Time (Per Specification)	Automatic	After any program changes.		NA		
E5.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily fo automatic controls, every 8 hours for systems without controllers.		NA		
€5.5	Impurity Content Check Per chemical supplier recommendation.	Manual	Once per week*.		NA		
E5.6	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA		
6.0	Electrolytic Strike, Immersion, or Electroless Deposits						
	Туре:				NA		
	Size, volume:				NA		
	Chemical supplier:				NA		
E6.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.		NA		
E6.2	pH (if applicable)	Manual	Once every 8 hours*.		NA		
E6.3	Concentration	Manual	Once per day.		NA		
E6.4	Time	Automatic	After any program changes.		NA		
E6.5	Agitation	Automatic	Per process sheet.		NA		
E6.6	Amperage or Voltage Control- if applicable	Automatic	Once every 8 hours*.		NA		
E6.7	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily fo automatic controls, every 8 hours for systems without controllers.		NA		
E6.8	Impurity Content Check Per chemical supplier recommendation.	Manual	Once per week*.		NA		
E6.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.		NA		
7.0	Electropolish (If Applicable)						
	Туре:				NA		
	Size, volume:				NA		
	Chemical supplier:				NA		
€7.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.		NA		
€7.2	Concentration(s)	Manual	Once per day*		NA		
€7.3	Time	Automatic or Manual	After any program changes.		NA		
E7.4	Agitation	Automatic	Per process sheet.		NA		
E7.5	Current/Voltage	Automatic or Manual	Once every 8 hours.		NA		



			Continuous monitoring by controller Manually and deliver-		
E7.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
E7.7	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
	Chromium (If Applicable)				
8.0	Hexavalent Chromium				
	Type:			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
E8.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.	NA	
E8.2	Concentration(s)	Manual	Once every 4 hours*	NA	
E8.3	Time	Automatic	After any program changes.	NA	
E8.4	Agitation (if applicable)	Automatic	Once every 8 hours.	NA	
E8.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	NA	
E8.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
E8.7	Impurity Content Check Per chemical supplier recommendation e.g., metallic contamination.	Manual	Once per month.	NA	
E8.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
9.0	Trivalent Chromium				
	Type:			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
E9.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.	NA	
€9.2	Concentration(s)	Manual	Once every 4 hours*	NA	
E9.3	Time	Automatic	After any program changes.	NA	
€9.4	Agitation (if applicable)	Automatic	Once every 8 hours.	NA	
€9.5	Current/Voltage	Automatic or Manual	Once every 8 hours.	NA	
E9.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
	Impurity Content Check Per chemical supplier recommendation e.g., Metallic contamination.	Manual	Once per week*	NA	
E9.8	Appearance verification per OEM Master Standard or OEM Certified Production part.	Manual	Once every 8 hours.	NA	
E9.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
10.0	Rinse (This section is to be repeated as necessary to doc process line. In cases of sequential rinses this section co		entire	·	



Conforming Nonconforming NA
NA
Conforming Nonconforming NA
_



How do you inspect for the integrity of the racks and fixtures? (i.e., broken electrical contacts, plating build up, plastisol rack coating and other damage) Where are the inspection results documented?		NA
Describe your preventive maintenance program for racks and fixtures.		NA
How is each rack or fixture identified for tracking purposes?		NA
Rectifiers shall be maintained. The Plater shall have a preventive maintenance system that is documented and implemented	d.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for rectifiers used in production and in the laboratory (i.e., voltage, amperage and ripple)		NA
Is the ripple reading within the maximum allowable limit recommended by the chemical supplier?		NA
All Anodes, Contacts and Bussing shall be maintained. Organization shall have preventive maintenance system that is documented and implemente	rd.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for anodes of all types including inert, consumable, bags, baskets and auxiliary.		NA
Describe the preventive maintenance program for contacts and electrical bussing including cleanliness, high electrical resistance, electrical shorts		NA
E12.5 All filters shall be maintained. The organization shall have a preventive maintenance system that is documented and implementations.	mented.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for all plating solution filters to include plate, filter bag and cartridge		NA
Describe the preventive maintenance program for all air filters used on ovens, dryers, chillers, blowers and fans etc.		NA
All process and equipment alarms shall be tested on a quarterly basis at a minimum. The organization shall have a preventive maintenance system that is documented and implementations.	mented.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program where alarms are used for amperage, voltage, heating, cooling, level control, air circulation and air agitation etc.		NA
Provide a list of all the alarms that are tested and the test frequency.		NA
E12.7 All process equipment including the tanks have a maintenance schedule that is documented	and followed.	1
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
The preventive maintenance schedule should include a list of equipment that is in use with the associated process. (i.e., Tanks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level control, air circulation and air agitation etc.)		NA



D"	a the mathed word to develop and decreases the majetaness are selected.	T. C.	1
	e the method used to develop and document the maintenance schedule. inted, electronic)		NA
Provide	an example of a completed sign off record.		NA
13.0	Test Equipment		•
E13.1	Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.		
	Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Wet An Before	alysis: use, chemicals must be checked for shelf life and/or expiration date.		NA
pH / Co	onductivity Meter		NA
pH / Co	onductivity Probes		NA
Solution	n compatible probes must be used.		NA
Labora	tory Balance (Weight Scale) (Optional)		NA
Atomic	Absorption (AA) or Inductively Coupled Plasma (ICP)		NA
X-Ray I	Fluorescence (XRF) (Optional)		NA
Lab Re	ctifier		NA
Hand h	eld thermometer		NA
Pipettes	s - Before use, pipettes must be checked for broken tips		NA
CASS	Cabinet		NA
Thickne	ess Tester		NA
Lab Ov	en		NA



PROCESS TABLE F - Hard Chrome Plating

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

For multiple tanks that serve the same purpose copy and paste sections as needed.

Process Line Identification:

	Category/Process Steps	ory/Process Steps Type of Control Monitoring Frequency		Observation/ Comments	Job Audit Measurements			
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirements	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
1.0	Metal Cleaning							
	Туре:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
F1.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify daily.		NA		
F1.2	Concentration	Manual		Once per day.		NA		
F1.3	Time	Automatic		After any program changes.		NA		
F1.4	Agitation	Automatic		Per process sheet.		NA		
F1.5	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
F1.6	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
2.0	Mechanical Preparation (If Applicable)							
F2.1	Polishing/Buffing:					NA		
F2.2	Wheel revolutions per minute (rpm)	Automatic or Manual		Per process sheet.		NA		
F2.3	Buffing wheel material	Manual		Per process sheet.		NA		
F2.4	Buffing wheel compound	Automatic/Manual		Per process sheet.		NA		
F2.5	Surface profile is checked after process (if applicable).	Manual		Every load.		NA		
F2.6	Abrasive Blast Process:					NA		
F2.7	Media type	Manual		Every part change.		NA		
F2.8	Blasting media size/life: - Media size is being checked on a regular schedule to determine effective cleaning and life of product mix.	Manual		Per preventive maintenance schedule, once per week minimum.		NA		
F2.9	Abrasive media flow or nozzle air pressure: - Blasting force is set and maintained within control limits.	Automatic or Manual		Per process sheet.		NA		
F2.10	Dwell time is clearly defined If additional blasting is required, management approval is needed.	Automatic or Manual		Per process sheet.		NA		



F0.44	Alexander de la contraction de	[sa	5	l	1	
F2.11	Abrasive media level	Manual	Every load.	NA		
F2.12	Surface cleanliness is checked after process. Copper Sulfate Test (Hogeboom Test).	Manual	Every load.*	NA		
F2.13	Surface profile is checked after process (if applicable).	Manual	Every load.	NA		
3.0	Acid Activation (if applicable)					
	Type:			NA		
	Size, volume:			NA		
	Chemical supplier:			NA		
F3.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 3°C (5°F).	Continuous monitoring by controller. Manually verify daily.	NA		
F3.2	Concentration	Automatic or Manual	Once per day.	NA		
F3.3	Time	Automatic or Manual	Per process sheet.	NA		
F3.4	Agitation or Circulation (if applicable)	Automatic	Per process sheet.	NA		
F3.5	Current/Voltage (if applicable)	Automatic or Manual	Once every 8 hours.	NA		
F3.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		
F3.7	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
4.0	Chrome Plate					
	Type:			NA		
	Size, volume:			NA		
	Chemical supplier:			NA		
F4.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 1°C (2°F).	Continuous monitoring by controller. Manually verify daily.	NA		
F4.2	Concentration	Manual	Once per day.	NA		
F4.3	Metallic impurity concentrations of Fe, Cr+3, Cu, and Ni.	Manual	Once per week.	NA		
F4.4	Time	Manual	After any program changes.	NA		
F4.5	Agitation or Circulation	Automatic	At start of each shift.	NA		
F4.6	Current/Voltage	Automatic or Manual	Once every 8 hours.	NA		
F4.7	Ramp Schedule (if applicable)	Automatic or Manual	Per process sheet.	NA		
F4.8	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		
F4.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
5.0	Rinse (This section is to be repeated as necessary to document all individual rinse steps in the entire process line. In cases of sequential rinses this section covers the final rinse of the sequence)					
F5.1	Rinse Type - Identify in comment section e.g., Flowing, Counter Flowing, Spray, Stagnant, Drag-in/out, etc.	NA	NA	NA		
F5.2	Water Type- Identify in comment section e.g., Municipal, Deionized (DI),Reverse Osmosis (RO), etc.	NA	NA	NA		
F5.3	Agitation type - Identify in comment section (if applicable) e.g., Mechanical (Describe), Air, Ultrasonic, etc.	NA	NA	NA		



EE 4							
F5.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA	
F5.5	Temperature (Thermocouple) (if applicable)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Once every 8 hours.		NA	
F5.6	Rinse Quality - Identify in comment section e.g., pH, Impurity Check, Conductivity.	Manual		Once every 8 hours.*		NA	
F5.7	Flow rate (if applicable)	Manual		Once every 8 hours.		NA	
F5.8	Spray nozzle condition (if applicable)	Manual		Once every 8 hours.		NA	
F5.9	Verify position of incoming water feed is near the bottom (if immersion tank).	Manual		Per preventive maintenance program.		NA	
F5.10	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA	
6.0	Drying		.			•	
F6.1	Drying Time	Automatic		Per Process Sheet and TDS.		NA	
F6.2	Drying Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Per Process Sheet and TDS.		NA	
F6.3	Verify operation of blowers and/or rotation of dryer.	Manual		Once per 8 hours.		NA	
F6.4	There is a procedure to ensure dryness of parts.	Manual		Every container and rack.		NA	
7.0	Process Equipment						
F7.1	Process equipment shall be verified and calibrated per Proces Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment Complete the audit for these identified elements in Process Ta	<u>.</u>					
l	Guidance						Conforming
1	Guidance			Objective Evidence / Comm	nents		Nonconforming NA
	the internal system used for conducting and managing calibrati d in Process Table I?	on of all relevant equipment		Objective Evidence / Comm	nents		Nonconforming
identified	the internal system used for conducting and managing calibrati			Objective Evidence / Comm	nents		Nonconforming NA
identified Provide	the internal system used for conducting and managing calibrati d in Process Table I?			Objective Evidence / Comm	nents		Nonconforming NA
Provide How do How do	the internal system used for conducting and managing calibrati d in Process Table I? the document that lists all relevant equipment identified in Proc	ess Table I.		Objective Evidence / Comm	nents		Nonconforming NA NA
Provide How do How do has bee	the internal system used for conducting and managing calibrati d in Process Table I? the document that lists all relevant equipment identified in Proc you ensure calibrations are up to date? you ensure new equipment has been added to the calibration li	ess Table I.		Objective Evidence / Comm	nents		Nonconforming NA NA NA NA
Provide How do How do has bee	the internal system used for conducting and managing calibrati d in Process Table I? the document that lists all relevant equipment identified in Proc you ensure calibrations are up to date? you ensure new equipment has been added to the calibration lin removed?	ess Table I.		Objective Evidence / Comm	nents		Nonconforming NA NA NA NA NA NA
Provide How do How do has bee	the internal system used for conducting and managing calibrati d in Process Table I? the document that lists all relevant equipment identified in Proc you ensure calibrations are up to date? you ensure new equipment has been added to the calibration lin in removed? pration labels present and up to date for listed equipment?	ess Table I. st, and inactive equipment	ı.	Objective Evidence / Comm	nents		NA NA NA NA NA
identified Provide How do How do has bee Are calib What is	the internal system used for conducting and managing calibrati d in Process Table I? the document that lists all relevant equipment identified in Process you ensure calibrations are up to date? you ensure new equipment has been added to the calibration lin removed? pration labels present and up to date for listed equipment? the reaction plan to any failed verification? Racks and fixtures shall be maintained.	ess Table I. st, and inactive equipment	1.	Objective Evidence / Comm			NA NA NA NA NA
identified Provide How do How do has bee Are calib What is F7.2 How do (i.e., bro	the internal system used for conducting and managing calibratic din Process Table I? the document that lists all relevant equipment identified in Process you ensure calibrations are up to date? you ensure new equipment has been added to the calibration lin removed? pration labels present and up to date for listed equipment? the reaction plan to any failed verification? Racks and fixtures shall be maintained. Organization shall have preventive maintenance system that in	ess Table I. st, and inactive equipment	1.				NA N
identified Provide How do How do has bee Are callit What is F7.2 How do (i.e., bro Where a	the internal system used for conducting and managing calibratic din Process Table I? the document that lists all relevant equipment identified in Process you ensure calibrations are up to date? you ensure new equipment has been added to the calibration lin removed? pration labels present and up to date for listed equipment? the reaction plan to any failed verification? Racks and fixtures shall be maintained. Organization shall have preventive maintenance system that in the control of the co	ess Table I. st, and inactive equipment	1.				Nonconforming NA NA NA NA NA NA NA Conforming NOnconforming NA



Rectifiers shall be maintained. The Plater shall have a preventive maintenance system that is documented and implemented	d.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for rectifiers used in production and in the laboratory (i.e., voltage, amperage and ripple).		NA
is the ripple reading within the maximum allowable limit recommended by the chemical supplier?		NA
All Anodes, Contacts and Bussing shall be maintained. Organization shall have preventive maintenance system that is documented and implemente	ed.	·
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for anodes of all types including inert, consumable, pags, baskets and auxiliary.		NA
Describe the preventive maintenance program for contacts and electrical bussing including cleanliness, high electrical resistance, electrical shorts		NA
All filters shall be maintained. The organization shall have a preventive maintenance system that is documented and implet	mented.	•
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program for all plating solution filters to include plate, filter bag and cartridge		NA
Describe the preventive maintenance program for all air filters used on ovens, dryers, chillers, plowers and fans etc.		NA
All process and equipment alarms shall be tested on a quarterly basis at a minimum. The organization shall have a preventive maintenance system that is documented and implei	mented.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program where alarms are used for amperage, voltage, neating, cooling, level control, air circulation and air agitation etc.		NA
Provide a list of all the alarms that are tested and the test frequency.		NA
F7.7 All process equipment including the tanks have a maintenance schedule that is documented	and followed.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
The preventive maintenance schedule should include a list of equipment that is in use with the associated process. i.e., Tanks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level control, air circulation and air agitation etc.)		NA
Describe the method used to develop and document the maintenance schedule. i.e., printed, electronic)		NA
Provide an example of a completed sign off record.		NA
8.0 Test Equipment		•



F8.1

Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.

Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Wet Analysis: Before use, chemicals must be checked for shelf life and/or expiration date.		NA
pH / Conductivity Meter		NA
pH / Conductivity Probes		NA
Solution compatible probes must be used.		NA
Laboratory Balance (Weight Scale) (Optional)		NA
Atomic Absorption (AA) or Inductively Coupled Plasma (ICP)		NA
Ion Chromatography (Optional)		NA
Selective Ion Electrodes (Optional)		NA
X-Ray Fluorescence (XRF) - (Optional)		NA
Lab Rectifier		NA
Hand held thermometer		NA
Pipettes - Before use, pipettes must be checked for broken tips		NA
Thickness Tester		NA
Lab Oven		NA



PROCESS TABLE G - Electroless Nickel

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented.

If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

For multiple tanks that serve the same purpose copy and paste sections as needed.

Process Line Identification:

	Category/Process Steps	Type of Control		Monitoring Frequency		Observation/ Comments	Job Audit Measurements	
ITEM #		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit
	STEEL, BRASS, BRONZE							
	Soak Cleaner Precleaning							
	Type: (e.g., Alkaline, Neutral, Acidic, Spray, Immersion, Ultrasonic)					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
G1.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.		NA		
G1.2	Concentration(s)	Manual		Once per day.		NA		
	Impurity Content Check Per chemical supplier recommendation Examples: Acid split for oil loading, alkalinity ratio.	Manual		Once per week.		NA		
G1.4	Time	Automatic or Manual		Per process sheet and after program changes.		NA		
G1.5	Agitation	Automatic		Per process sheet.		NA		
G1.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
G1.7	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
2.0	Ultrasonic Cleaner							
G2.1	Ultrasonics functionality check - Frequency settings of ultrasonics - Power Density (e.g., Watts per liter) - Test for output (e.g., aluminum foil).	Automatic or Manual		Once per week.		NA		
G2.2	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.		NA		
G2.3	Cleaner Concentration	Manual		Once per day.		NA		
G2.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		



G2.5	Electrical equipment inspection (connectors, diodes, generators, transducers, equipment temperature, etc.).	Manual	Once per week.	NA	
G2.6	Input voltage (with and without load, primary and secondary).	Manual	Every 6 months.	NA	
G2.7	Flowing Rinse	Automatic or Manual	Once every 8 hours.	NA	
G2.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
3.0	Alkaline Electrocleaner				
	Type: (e.g., Anodic, Cathodic, Periodic Reverse)			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
G3.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA	
G3.2	Concentration(s)	Manual	Once per day.	NA	
G3.3	Impurity Content Check Per chemical supplier recommendation Examples: Acid split for oil loading, alkalinity ratio.	Manual	Once per week.	NA	
G3.4	Tank maintenance schedule is documented and followed. Examples: Physical tank, pumps, piping, heaters, etc.	Manual	Per preventive maintenance program.	NA	
G3.5	Time	Automatic or Manual	Per process sheet and after program changes.	NA	
G3.6	Agitation	Automatic	Per process sheet.	NA	
G3.7	Current/Voltage	Automatic or Manual	Per process sheet and TDS Once every 8 hours.*	NA	
G3.8	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
G3.9	Flowing Rinse	Automatic	Once every 8 hours.	NA	
G3.10	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
4.0	Acid Activation				
	Type: (e.g., Sulfuric, Hydrochloric, Acid salts)			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
G4.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA	
G4.2	Concentration(s)	Manual	Once every 8 hours.*	NA	
G4.3	Metallic impurity concentration. Obtain metallic impurity limits from chemical supplier with required corrective actions.	Manual	Once per month.	NA	
G4.4	Time	Automatic or Manual	Per process sheet and after program changes.	NA	
G4.5	Agitation	Automatic	Per process sheet.	NA	
G4.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
G4.7	Flowing Rinse	Automatic	Once every 8 hours.	NA	
G4.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	



5.0	Soak Cleaner				
0.0	Type: (e.g., Alkaline, Neutral, Acidic)			l NA	
	Size, volume:			NA NA	
	Chemical supplier:			NA NA	
G5.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA NA	
G5.2	Concentration(s)	Manual	Once every 8 hours.*	NA	
G5.3	Impurity Content Check Per chemical supplier recommendation Examples: Acid split for oil loading, alkalinity ratio.	Manual	Once per week.	NA	
G5.4	Time	Automatic or Manual	Per process sheet and after program changes.	NA	
G5.5	Agitation	Automatic	Per process sheet.	NA	
G5.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
G5.7	Flowing Rinse	Automatic	Once every 8 hours.	NA	
G5.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
6.0	Etch				
	Type: (e.g., Acidic, Alkaline)			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
G6.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA	
G6.2	Concentration(s)	Manual	Once every 8 hours.*	NA	
G6.3	Metallic impurity concentrations of Al and Cu. Obtain limits from chemical supplier with required corrective actions.	Per process sheet and TDS	Once per month.	NA	
G6.4	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
G6.5	Time	Automatic or Manual	Per process sheet and after program changes.	NA	
G6.6	Agitation	Automatic	Per process sheet.	NA	
G6.7	Solution Level	Automatic or Manual	Once every 8 hours.	NA	
G6.8	Flowing Rinse	Automatic	Once every 8 hours.	NA	
G6.9	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
7.0	Deoxidizer/Desmutter				
	Type: Acid type (e.g., Nitric, sulfuric, fluoride, salts, etc.)			NA	
	Size, volume:			NA	
	Chemical supplier:			NA	
G7.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA	
G7.2	Concentration(s)	Manual	Once every 8 hours.*	NA	



G7.3	Metallic impurity concentrations of Al and Cu. Obtain limits from chemical supplier with required corrective actions.	Per process sheet and TDS	Once per month.	NA		
G7.4	Time	Automatic or Manual	Per process sheet and after program changes.	NA	١	
G7.5	Agitation	Automatic	Per process sheet.	NA	\	
G7.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		
G7.7	Flowing Rinse	Automatic	Once every 8 hours.	NA	١	
G7.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	1	
8.0	Zincate (and second Zincate)					
	Type:			NA	١	
	Size, volume:			NA	\	
	Chemical supplier:			NA	1	
G8.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA		
G8.2	Concentration(s)	Manual	Once every 8 hours.	NA	\	
G8.3	Bath Life: - Aluminum impurity concentrations - Surface area processed per gallon of solution	Per process sheet and TDS	Once per month.	NA		
G8.4	Time	Automatic or Manual	Per Process Sheet and TDS.	NA	1	
G8.5	Agitation	Automatic or Manual	Per Process Sheet and TDS.	NA	1	
G8.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		
G8.7	Flowing Rinse	Automatic	Once every 8 hours.	NA	1	
G8.8	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
9.0	Zincate Strip (when double Zincate)	·				
	Type: (e.g., Nitric, Proprietary acid mixtures)			NA	١	
	Size, volume:			NA	١	
	Chemical supplier:			NA	١	
G9.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA		
G9.2	Concentration(s)	Manual	Once every 8 hours.*	NA	1	
G9.3	Bath Life - Zinc impurity concentrations - Acid ratio Obtain limits from chemical supplier with required corrective actions.	Per process sheet and TDS	Once per month.	NA		
G9.4	Time	Automatic or Manual	Per process sheet and after program changes.	NA	\	
G9.5	Agitation	Automatic	Per process sheet.	NA	\	
G9.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		



		<u> </u>		1	I	
G9.7	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
10.0	Rinse (This section is to be repeated as necessary to door process line. In cases of sequential rinses this section co					
G10.1	Rinse Type - Identify in comment section e.g., Flowing, Counter Flowing, Spray, Stagnant, Drag-in/out, etc.	NA	NA	NA		
G10.2	Water Type- Identify in comment section e.g., Municipal, Deionized (DI),Reverse Osmosis (RO), etc.	NA	NA	NA		
G10.3	Agitation type - Identify in comment section (if applicable) e.g., Mechanical (Describe), Air, Ultrasonic, etc.	NA	NA	NA		
G10.4	Solution Level - Parts, heaters, and transducers are completely submerged	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		
G10.5	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify once every 8 hours. Automatic.	NA		
G10.6	Rinse Quality - Identify in comment section e.g., pH, Impurity Check, Conductivity	Manual	Once every 8 hours.*	NA		
G10.7	Flow rate (if applicable)	Manual	Once every 8 hours.	NA		
G10.8	Spray nozzle condition (if applicable)	Manual	Once every 8 hours.	NA		
G10.9	Verify position of incoming water feed is near the bottom (if immersion tank)	Manual	Per preventive maintenance program.	NA		
G10.10	Spray nozzle condition (if applicable)	Manual	Once every 8 hours.	NA		
G10.11	Tank maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
G10.12	Verify position of incoming water feed is near the bottom of the immersion tank	Manual	Per preventive maintenance program.	NA		
G10.13	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA		
11.0	EN Strike (optional process)	1			•	
	Type: (e.g., Alkaline, Acid)			NA		
	Size, volume:			NA		
	Chemical supplier:			NA		
G11.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify every 30 minutes. Automatic.	NA		
G11.2	Nickel Concentration	Automatic or Manual	Prior to production start-up. Automatic: verify daily. Manually: Frequency of manual tests shall ensure a minimum 80% activity concentration, or per specifications.	NA		
G11.3	Time	Automatic or Manual	Per process sheet and after program changes.	NA		
G11.4	Agitation	Automatic	Per process sheet.	NA		
G11.5	Solution pumps turn over rate is minimum 10 times per hour.	Manual	Per preventive maintenance program	NA		
G11.6	Hypophosphite concentration	Manual	Prior to production start-up and once every 8 hours.*	NA		
G11.7	Solution loading (surface area of parts per volume plating solution)	Manual	Per process sheet.	NA		
G11.8	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA		



G11.9	рН	Automatic or Manual	Once every 30 minutes while running.*	NA	
G11.10	Continuous filtration	Automatic	Visual for good solution flow/clogged filters every 8 hours.	NA	
G11.11	Bath life (metal turnovers) (calculate by specific gravity or orthophosphite or nickel adds made)	Manual	Per process sheet. Continuous tracking of nickel additions, and titration of Orthophosphite/specific gravity minimum 1 per week.	NA	
G11.12	Process water conductivity	Manual, per supplier recommendation	Once per day.	NA	
G11.13	Contamination (e.g., Nitrates, Zinc, Iron and Aluminum) Obtain limits from chemical supplier with required corrective actions.	Manual	Once per day.	NA	
G11.14	Flowing Rinse (optional)	Automatic	Once every 8 hours.	NA	
G11.15	Tank and solution maintenance schedule documented and followed.	Manual	Per preventive maintenance program.	NA	
12.0	Electroless Nickel, Nickel Alloys, and Nickel Composites				
	Type: (High phos, Mid Phos, Low Phos, Nickel Boron, Nickel Teflon, etc.)			NA	
	Size, volume:			NA	
	Chemical supplier:			 NA	
G12.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).	Continuous monitoring by controller. Manually verify every 30 minutes. Automatic.	NA	
G12.2	Time (and thickness)	Manual (per thickness)	Per process sheet.	NA	
G12.3	Agitation	Automatic	Per process sheet and supplier TDS.	NA	
G12.4	Nickel Concentration	Automatic or Manual	Prior to production start-up. Automatic: verify daily. Manually: once every 30 minutes while running. Frequency of manual tests shall be increased for high volume loading to maintain a minimum 80% activity concentration, or per specification.	NA	
G12.5	Specialty Electroless Nickel Alloy and Composite concentration	Automatic or Manual	Prior to production start-up. Automatic: verify daily. Manually: once every 30 minutes while running. Frequency of manual tests shall be increased for high volume loading to maintain a minimum 80% activity concentration, or per specification.	NA	
G12.6	Hypophosphite concentration or Reducing agent (for specialty alloys)	Manual	Prior to production start-up and once every 8 hours.*	NA	
G12.7	Solution loading (surface area of parts per volume plating solution)	Manual	Verify each lot against process sheet.	NA	
G12.8	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual	Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.	NA	
G12.9	Bath life (metal turnovers) Calculate by specific gravity or orthophosphite content or nickel adds made	Manual	Per process sheet and TDS. Continuous (Daily) tracking of nickel additions, and titration of orthophosphite/specific gravity minimum 1 per month.	NA	
G12.10	рН	Automatic or Manual	Once every 30 minutes while running.*	NA	
G12.11	Filtration - Solution Turn-over - Filter micron size	Continuous with solution turn- over rate per process sheet & TDS	For bag filters: Visual for good solution flow/clogged/ evidence of plate-out of filters every 8 hours. For cartridge filters: Measure pressure drop/back pressure every 8 hours.	NA	
G12.12	Anodic protection (if applicable) - Voltage - Cathode surface area (300 to 400:1 of anode:cathode) - Stripping/replacement of cathode	Manual, per supplier recommendation	Voltage and surface area: Once every 8 hours. Cathode maintenance: As required to maintain proper anode:cathode ratio.	NA	



G12.13	Equipment plate-out	Manual		Manually verify every 30 minutes while running.		NA		
G12.14	Hardness Test (if applicable)	Manual		Per Process Sheet and TDS.		NA		
G12.15	Phosphorous or alloy content	Manual		Per Process Sheet and TDS.		NA		
G12.16	Water quality	Manual, per supplier recommendation		Once per day.		NA		
G12.17	Contamination (e.g., Nitrates from stripping tanks) Obtain limits from chemical supplier with required corrective actions.	Manual, per supplier recommendation		Once per day.		NA		
G12.18	Flowing Rinse	Automatic		Once every 8 hours.		NA		
G12.19	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
13.0	Post Treatment (Seals, Blackeners, Rinse Aids, etc. if applicable)							
	Type:					NA		
	Size, volume:					NA		
	Chemical supplier:					NA		
G13.1	Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Continuous monitoring by controller. Manually verify once every 8 hours.		NA		
G13.2	Concentration(s)	Manual		Once every 8 hours.		NA		
G13.3	Impurities Obtain limits from chemical supplier with required corrective actions.	Per process sheet and TDS		Once per month.		NA		
G13.4	Time	Automatic or Manual		Per Process Sheet and TDS.		NA		
G13.5	Agitation	Automatic or Manual		Per Process Sheet and TDS.		NA		
G13.6	Solution Level - Parts, heaters, and transducers are completely submerged.	Automatic or Manual		Continuous monitoring by controller. Manually verify daily for automatic controls, every 8 hours for systems without controllers.		NA		
G13.7	Flowing Rinse	Automatic		Once every 8 hours.		NA		
G13.8	Tank and solution maintenance schedule documented and followed.	Manual		Per preventive maintenance program.		NA		
14.0	Drying							
G14.1	Drying Time	Automatic		Once per day.		NA		
G14.2	Drying Temperature (Thermocouple)	Automatic Max SAT difference allowed +/- 5°C (10°F).		Per Process Sheet and TDS.		NA		
G14.3	Verify operation of blowers and/or rotation of dryer.	Manual		Once per 8 hours.		NA		
G14.4	There is a procedure to ensure dryness of parts.	Manual		Every container and rack.		NA		
15.0	Heat Treatment for Hardness (if applicable)	Covered by Pyrometry - Unique co	conditions to	emphasize below				
G15.1	Inert gas pressure set point(s) and limits are verified and documented.	Manual		Start of bake cycle and every batch change.		NA		
G15.2	Bake - time delay between plating and bake - total time documented	Automatic/Manual		Every baking batch.		NA		
16.0	Process Equipment							
	10000							



Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
All filters shall be maintained. The organization shall have a preventive maintenance system that is documented and implet Cartridge filters shall not be reused.	mented. If bag filters are stripped and reused, the number of re-use shall be tracked, and not exceed 3 strip/reuse cycles.	T
Describe the preventive maintenance program for contacts and electrical bussing including cleanliness, high electrical resistance, electrical shorts.		NA
Describe the preventive maintenance program for anodes of all types including inert, consumable, bags, baskets and auxiliary.		NA
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
G16.4 All Anodes, Contacts and Bussing shall be maintained. Organization shall have preventive maintenance system that is documented and implemente	d.	
Is the ripple reading within the maximum allowable limit recommended by the chemical supplier?		NA
Describe the preventive maintenance program for rectifiers used in production and in the laboratory (i.e., voltage, amperage and ripple).		NA
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Rectifiers shall be maintained. The Plater shall have a preventive maintenance system that is documented and implemented.	d.	
How is each rack or fixture identified for tracking purposes?		NA
Describe your preventive maintenance program for racks and fixtures.		NA
How do you inspect for the integrity of the racks and fixtures? (i.e., broken electrical contacts, plating build up, plastisol rack coating and other damage) Where are the inspection results documented?		NA
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
G16.2 Racks and fixtures shall be maintained. Organization shall have preventive maintenance system that is documented and implemente	d.	
What is the reaction plan to any failed verification?		NA
Are calibration labels present and up to date for listed equipment?		NA
How do you ensure new equipment has been added to the calibration list, and inactive equipment has been removed?		NA
How do you ensure calibrations are up to date?		NA
Provide the document that lists all relevant equipment identified in Process Table I.		NA
What is the internal system used for conducting and managing calibration of all relevant equipment dentified in Process Table I?		NA
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Process equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.		



Describe the preventive maintenance program for all plating solution filters to include plate, filter bag and cartridge.		NA
Describe the preventive maintenance program for all air filters used on ovens, dryers, chillers, blowers and fans etc.		NA
G16.6 All process and equipment alarms shall be tested on a quarterly basis at a minimum. The organization shall have a preventive maintenance system that is documented and imple	mented.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Describe the preventive maintenance program where alarms are used for amperage, voltage, heating, cooling, level control, air circulation and air agitation etc.		NA
Provide a list of all the alarms that are tested and the test frequency.		NA
G16.7 All process equipment including the tanks have a maintenance schedule that is documented	and followed.	
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
The preventive maintenance schedule should include a list of equipment that is in use with the associated process. (i.e., Tanks, liners pumps, plumbing, heaters, ventilation, coalescer, rectifier, heating, cooling, level control, air circulation and air agitation etc.).		NA
Describe the method used to develop and document the maintenance schedule. (i.e., printed, electronic).		NA
Provide an example of a completed sign off record.		NA
17.0 Test Equipment		
Test Equipment shall be verified and calibrated per Process Table I. Calibrations shall be certified, posted and up to date. A system shall be used to track calibration dates of equipment. Complete the audit for these identified elements in Process Table I.		
Guidance	Objective Evidence / Comments	Conforming Nonconforming NA
Wet Analysis: Before use, chemicals must be checked for shelf life and/or expiration date.		NA
pH / Conductivity Meter		NA
pH / Conductivity Probes		NA
Solution compatible probes must be used.		NA
Dedicated probes must be used for chromates / passivates.		NA
Laboratory Balance (Weight Scale) (Optional)		NA
Atomic Absorption (AA) or Inductively Coupled Plasma (ICP)		NA
X-Ray Fluorescence (XRF)		NA
Lab Rectifier		NA
Hand held thermometer		NA
Pipettes - Before use, pipettes must be checked for broken tips		NA
Salt Spray Cabinet		NA



Thickness Tester	NA
Lab Oven	NA
Profilometer (Optional)	NA



PROCESS TABLE H - Hydrogen Embrittlement Relief Process

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. When performing the job audit, the auditor shall verify plater is conforming to customer requirements.

This table shall be completed separately for each hydrogen embrittlement relief oven.

Definitions:

Time from the end of the plating tank: This is the time at which the parts exit the electrolytic plating step and before entering any rinses, passivates, etc.

Process Line Identification: Automated Hoist / Rack Plating Line

Type of Oven: Batch or Continuous

	Category/Process Steps	Category/Process Steps Type of Control		Monitoring Frequency	lonitoring Frequency		Job Audit I	Job Audit Measurements	
ITEM#		Minimum Requirement	Actual Condition	Minimum Requirement	Actual Condition	Conforming Nonconforming NA	Range	Actual Measurements supporting time of Job Audit	
1.0					•		•		
H1.1	Process must be in place that limits the acid immersion time in the plating process.	Automatic	automatic	No more than ten minutes. If more than ten minutes, parts need to be quarantined, and follow customer reaction plan.	max 3 min	Conforming	N/A	N/A	
H1.2	All parts for hydrogen embrittlement relief must reach bake temperature within two hours after exiting the electroplating tank. Refer to Pyrometry Section for probe placement.	Automatic/Manual	Manual	Time from parts exiting plating tank to exiting plating line. Time required for sufficient amount of parts to be loaded into the de-embritlement oven. The amount of parts shall represent the maximum load size/rate into the oven. Time to temperature per TUS for a maximum load. The total accumulated time for items 1-3 shall be under 2 hours.	All loads are tracked digitally with MasterTracker software and time into baking is displayed on screen to ensure operators are informed and compliance is achieved	Conforming	N/A	N/A	
H1.3		Automatic Max SAT difference allowed +/- 5°C (10°F)		Start of bake cycle and every batch change.	Annual Calibration completed	Conforming	N/A	N/A	
H1.4	Oven temperature is monitored and recorded.	Automatic		A continuous data recorder must be used with a temperature control alarm.	Continuous data recorder with alarm	Conforming	N/A	N/A	
H1.5	For hydrogen embrittlement relief ovens, are temperature uniformity surveys performed as defined by Pyrometry Section 3.	Manual		Uniformity survey must show that ovens were tested with a full production load. The applicator shall demonstrate that the time from plating to baking temperature can be reached within the time limit set by customer requirements.	Temperature reached within the time limit	Conforming	N/A	N/A	



H1.6	For hydrogen embrittlement relief ovens, are thermocouples checked and/or replaced as defined by Pyrometry Sections 3, 3.1 and 3.3.	Manual	Plater shall have preventive maintenance system that is documented and implemented.	PM system documented	Conforming	N/A	N/A
H1.7	Electronic or mechanical records (not hand-written) must be kept for the following: - Time out of plating line - Time at start of bake cycle - Time at end of bake cycle	Automatic/Manual	For every oven batch the applicator shall record: - Time out of plating line - Time at start of bake cycle - Time at end of bake cycle	All records are retained digitally, all baking requirements are part specific and managed via production software	Conforming	N/A	N/A
H1.8	Air filter (if used) change as scheduled.	Manual	Per oven manufacturer, filter supplier recommendation	See PM system database		N/A	N/A
H1.9	Bake oven logs for each oven batch are reviewed and verified.	Manual	Before shipment of each batch, an independent inspector (other than operator) shall verify: - Time out of plating line - Time at the start of bake cycle - Time at end of bake cycle Additionally verify the following meet process specifications: - Time to temperature - Length of bake cycle at temperature	All records are displayed on a screen by the ovens for supervisors and/or lead inspectors to review multiple times per shift or as necessary	Conforming	N/A	N/A
H1.10	Hydrogen embrittlement relief must be performed per customer requirements before rework.		The rework documents must include: - Time out of plating line - Time at the start of bake cycle - Time at end of bake cycle	All records are retained digitally, all baking requirements are part specific and managed via MasterTracker production	Conforming	N/A	N/A



PROCESS TABLE I - Process Control and Testing Equipment Verification and Calibration

All requirements given below are subordinate to applicable customer/OEM specific requirements.

The customer may have additional requirements, e.g., inspection testing, greater frequencies, etc. The auditor shall verify plater is conforming to customer requirements.

*If minimum requirements are not met, provide supporting records to justify actual conditions. To justify reduced monitoring frequencies, a minimum of 30 consecutive measurements (data points) at stated frequencies must be documented. If any data points at reduced monitoring frequencies are outside of control limits, then revert back to the frequencies stated under the minimum requirements.

For multiple tanks that serve the same purpose copy and paste sections as needed.

ITEM #	EQUIPMENT TYPE	Verification Frequency	Conforming Nonconforming NA	Calibration / Certification Frequency	Conforming Nonconforming NA	Observation / Comments
1.0			· I		·	
11.1	Before use, chemicals must be checked for shelf life and/or expiration date.	Daily	Conforming	NA	Conforming	Before each use
11.2	Temperature Controller	Per Section 3 Pyrometry	Conforming	Annually	Conforming	
11.3	Thermocouple	Per Section 3 Pyrometry	Conforming	Per Section 3 Pyrometry	Conforming	
11.4	pH Meter	Per equipment manufacturer's specifications	Conforming	Annually	N/A	Calibration required for the probe, not the meter
I1.5	pH Probe	Once every 4 hours, using a minimum of 2 buffer solutions near the min and max of the chemical control range.	Conforming	NA	Conforming	Before each use
11.6	Conductivity Meter	Per equipment manufacturer's specifications	N/A	Annually	N/A	
11.7	Conductivity Probe	Once every 4 hours, using a minimum of 2 reference solutions near the min and max of the chemical control range.	N/A	NA	N/A	
H1.8	Ion Selective (ISE) Probe	Once every 4 hours, using a minimum of 2 reference solutions near the min and max of the chemical control range.	N/A	NA	N/A	
11.9	Laboratory Balance	Monthly using a minimum of 2 reference mass standards.	Conforming	Annually	Conforming	
11.10	Atomic Absorption (AA)	Before each use.	Conforming	Annually	Conforming	
11.11	Inductively Coupled Plasma (ICP)	Before each use.	N/A	Annually	N/A	
11.12	Ion Chromatography (IC)	Before each use.	N/A	Annually	N/A	
11.13	X-Ray Fluorescence (XRF)	Daily. Thickness and alloy for each combination of plating and substrate.	Conforming	Annually	Conforming	
11.14	Hardness Tester	Daily	N/A	Annually	N/A	
I1.15	Profilometer	Daily	N/A	Annually	N/A	
11.16	Lab Rectifier	NA	Conforming	Annually	Conforming	
11.17	Hand held digital thermometer	NA	N/A	Annually	Conforming	Replaced annually
11.18	Glass thermometer	Visual inspection before each use.	N/A	Annually	N/A	
11.19	Pipettes - Before use, pipettes must be checked for broken tips	Before each use	Conforming	NA	Conforming	
11.20	Salt Spray Cabinet	Daily	Conforming	Annually	Conforming	
11.21	Thickness Tester	Every 8 hours	Conforming	Annually	Conforming	
11.22	CASS Cabinet	Daily	Conforming	Annually	Conforming	
11.23	Microscope (Min 100X) with calibrated grid reticle for Pore/Crack Count	Daily	Conforming	Annually	Conforming	
11.24	Lab Oven	Per Section 3 Pyrometry	Conforming	Annually	Conforming	
11.25	Torque-tension/Friction Tester	NA	N/A	Annually	N/A	
11.26	Refractometer	Monthly	N/A	NA	N/A	
11.27	Spectrophotometer	Monthly	Conforming	Annually	Conforming	
11.28	Color Meter	Daily	Conforming	Annually	Conforming	
11.29	Gloss Meter	Monthly	Conforming	Annually	Conforming	
11.30	Digital Temperature Recorder (i.e., DataPaq)	NA	N/A	Annually	N/A	